


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: STATESVILLE_AV	Cross Street: BADGER_CT	Location: SW
ADA ID: F0DB4509827E	Ramp Type: Combination2Diag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

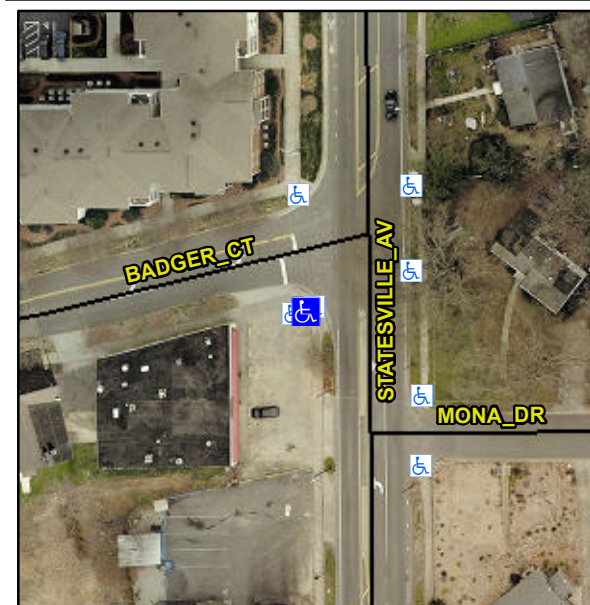

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Street 1 Name **None**  
 Stop Condition-Street 1 **STATESVILLE AV**  
 Street 2 Name **StopSign**  
 Stop Condition-Street 2 **BADGER CT**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	42.0	N/A	Ramp Length RT (in)	40.0
Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	48.0
Yes	Ramp Slope LT (%)	6.1	Yes	Ramp Slope RT (%)	2.3
Yes	Ramp XSlope LT (%)	1.1	Yes	Ramp XSlope RT (%)	0.6
N/A	Ramp Length (in)	25.0	Yes	Ramp Slope (%)	6.3
No	Ramp Width (in)	47.5	No	Ramp XSlope (%)	4.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.0		X Walk 2 Slope (%)	1.8
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	5.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6		Clear Space?	N/A
	Road X Slope (%)	3.8	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	22.9			

