
cole

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 14615	Main Street: MCMANUS_DR			Street:	ROSEHAVEN_DR	Location:	NE		
ADA ID: F3F0F74E2A03	Ramp Type: BlendTrans1			nitial Pass/Fail: Fail Overall Compliance: No				o Severity Score:	10
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	P	Possible Solutions:		Compliance Description			Data Compliance Description		Data
	Self Desig	Remove & Replace Curb Ram	p With	N/A	Ramp Length (in)	69.0	Yes	BlendTrans Slope (%)	1.7
		Two New Directional Ramps o		No	Ramp Width (in)	47.5	No	BlendTrans XSlope (%)	4.5
	and the second se	Equivalent.		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	10000			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
8	ST FREE TRANS			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	S S	Surveyor Notes:		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
	ALL ALL ALL	NO RT SW		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
	at a los a mais			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	ANUS			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
L Mar 1 the same	DR	-		N/A	Shared Landing?	N/A			
See 1 Martin	P	ROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
× 1 1. 500		Not Found, R304.5.1, R304.5.3	3	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
C Martine Martine				X Walk 1 Direction	To S		X Walk 2 Direction	N/A	
					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
Street 1 Name	MCMANUS DR				X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	N/A
Stop Condition-Street 1	StopSign				X Walk 1 X Slope (%)	7.1		X Walk 2 X Slope (%)	N/A
Street 2 Name	N/A			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 2	N/A				Road Slope (%)	7.1		Clear Space?	N/A
					Road X Slope (%)	1.5	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?		N/A	Storm Grate/Utility Hazard?	N/A
	То	otal Cost: \$	3200.00		Obstruction Type			Storm Grate/Utility Type	
		•			51	N/A		5 51	N/A
							1		



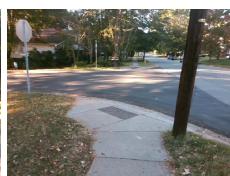



Yes

No

Surface Condition? (G/P)

Curb Slope (%)

Good

15.6