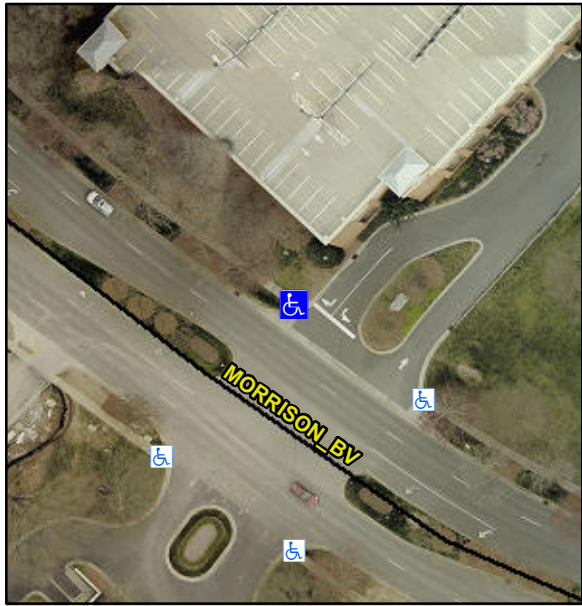


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10032191		Main Street: MORRISON_BV		Cross Street: N/A		Location:		NW											
ADA ID: F3F6E54CB939		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 25											
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance															
 <div>Street 1 NameENTRANCE</div> <div>Stop Condition-Street 1StopSign</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		60.0		N/A		Grade Break?		N/A		N/A	
						Yes		Ramp Width (in)		60.0		N/A		Grade Break Slope (%)		0.0		0.0	
						Yes		Ramp Slope (%)		7.6		N/A		Grade Break XSlope (%)		0.0			
						No		Ramp XSlope (%)		7.8									
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A			
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0			
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A			
						N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A			
						N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A			
		N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A							
		N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A							
		N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A							
		N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A							
		N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A							
		N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)		N/A							
		N/A		Painted X Walk1?		No				Road Slope (%)		2.7							
				X Walk 1 Direction		To SE				Road X Slope (%)		4.3							
				X Walk 1 Width (in)		N/A				Clear Space?		N/A							
				X Walk 1 Slope (%)		2.7		N/A		Clear Space to XWalk (in)		N/A							
				X Walk 1 X Slope (%)		4.3		N/A		Storm Grate/Utility Hazard?		N/A							
		N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type									
		N/A		Any Obstructions?		N/A						N/A							
				Obstruction Type				Yes		Surface Condition? (G/P)		Good							
								N/A		N/A		Curb Slope (%)		16.3					
Surveyor Notes:				N/A															
PROW/ADA:				R304.5.3															