


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 48423 Main Street: EVANTON LOCH RD **Cross Street: BEDLINGTON RD** Location: SE **ADA ID: F6AAF308561A** Ramp Type: BlendTrans1 Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

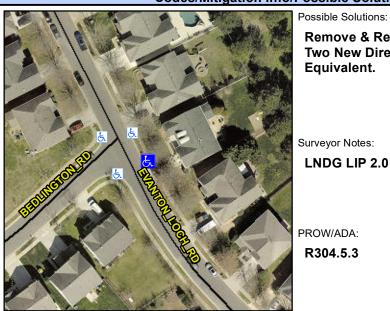

**EVANTON LOCH RD** Street 1 Name Stop Condition-Street 1 Street 2 Name Stop Condition-Street 2

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

**LNDG LIP 2.0** 

PROW/ADA:

R304.5.3

None
N/A
N/A

Total Cost: 3200.00

Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length (in)	47.0	Yes	BlendTrans Slope (%)	1.8
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	5.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.8		Clear Space?	N/A
	Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm Grate/Utility Type	
		N/A	l		N/A
			Yes	Surface Condition? (G/P)	Good
	A Transfer of the Control of the Con				

N/A

Curb Slope (%)

3.7





