


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: PENCE_POND_LN	Cross Street: PENCE_RD	Location: SW
ADA ID: FAEB4DC8DB54	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 10
			Field Measurements/Component Compliance

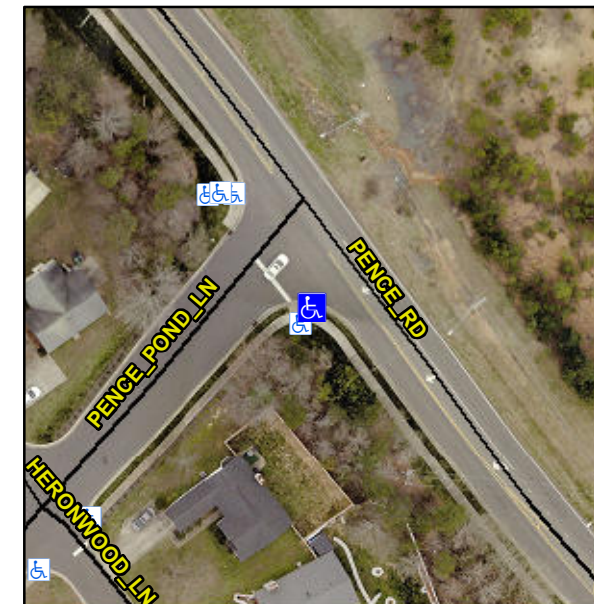

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3,  
R304.3.2, R304.2.1, R304.2.2-Perp,  
R304.3.2-Para, R302.7.2, R304.5.4**

Total Cost: \$ 2550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	42.0	N/A	Ramp Length RT (in)	50.0
Yes	Ramp Width LT (in)	59.5	Yes	Ramp Width RT (in)	59.5
No	Ramp Slope LT (%)	14.6	Yes	Ramp Slope RT (%)	2.1
No	Ramp XSlope LT (%)	3.5	No	Ramp XSlope RT (%)	3.3
N/A	Ramp Length (in)	107.0	Yes	Ramp Slope (%)	5.4
No	Ramp Width (in)	34.0	No	Ramp XSlope (%)	5.8
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
No	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	N/A	No	Gutter Slope (%)	N/A
No	Gutter Lip Ht (in)	N/A	No	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	N/A
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	16.1

