


Intersection ID: N/A	Main Street: ELGIN_MOOR_RD	Cross Street: DOUGLAS_PALACE_CT	Location:	NW
ADA ID: FDB7ECB5AA64	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

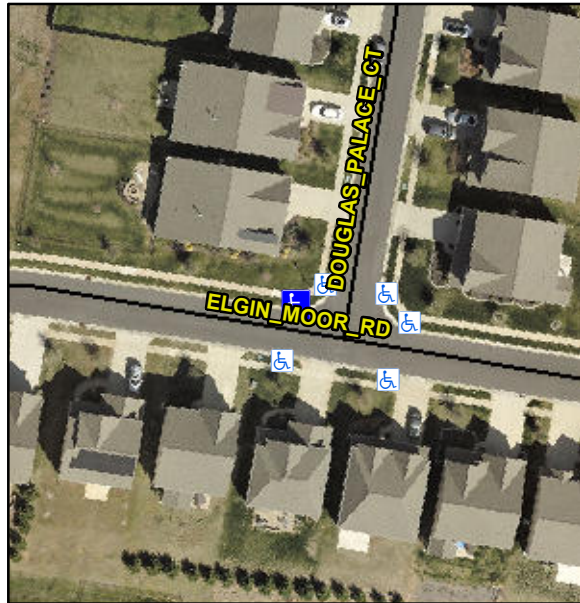

### Possible Solutions:

### Remove & Replace Entire Ramp.

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.2.2**

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
<b>Remove &amp; Replace Entire Ramp.</b>			N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	9.8
			No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	1.1
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes:			N/A	Shared Landing?	N/A			
<b>Not Found, R304.5.1, R304.2.2</b>			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	N/A
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Total Cost:			\$	1850.00		N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1850.00

