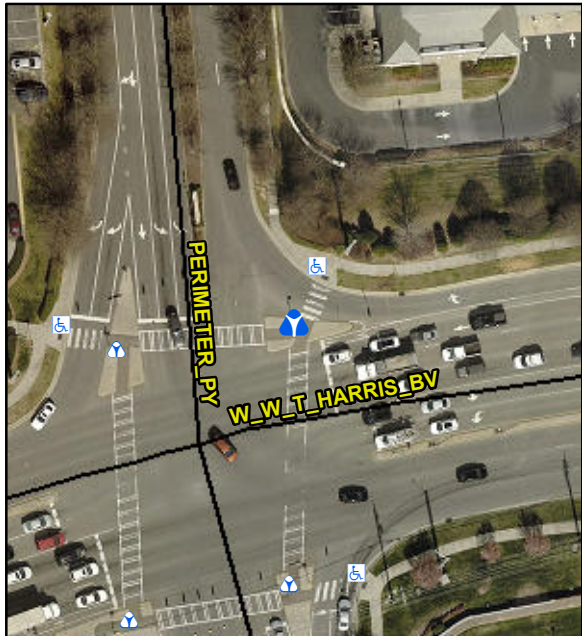


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 3559	Main Street: PERIMETER_PY	Cross Street: W_W_T_HARRIS_BV	Location: NE
ADA ID: 0B259B2538E3	Curb Cut Type: IslandRefuge3	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 36.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data	
	Remove & Replace Entire Refuge.		Yes	Refuge 1 Length (In)	178.0	N/A	Gutter 1 Ponding?	N/A	
			Yes	Refuge 1 Width (In)	72.0	N/A	Gutter 1 Lip Ht (In)	N/A	
			Yes	Refuge 1 Slope (%)	2.5	N/A	Gutter 1 Slope (%)	N/A	
			Yes	Refuge 1 X Slope (%)	0.3	N/A	Gutter 1 X Slope (%)	N/A	
			N/A	Painted X Walk1?	Yes	N/A	DWS 1 Provided?	N/A	
	Surveyor Notes:		N/A	X Walk 1 Direction	To W	N/A	DWS 1 Contrast?	N/A	
		N/A		N/A	X Walk 1 Width (In)	120.0	N/A	DWS 1 Length (In)	N/A
				N/A	Road 1 Slope (%)	0.1	N/A	DWS 1 Full Width?	N/A
				N/A	Road 1 X Slope (%)	3.0	N/A	DWS 1 Offset (In)	N/A
PROW/ADA:				Yes	Refuge 2 Length (In)	61.0	N/A	Gutter 2 Ponding?	N/A
			Yes	Refuge 2 Width (In)	78.0	N/A	Gutter 2 Lip Ht (In)	N/A	
		Yes	Refuge 2 Slope (%)	0.6	N/A	Gutter 2 Slope (%)	N/A		
		Yes	Refuge 2 X Slope (%)	4.3	N/A	Gutter 2 X Slope (%)	N/A		
		N/A	Painted X Walk2?	Yes	N/A	DWS 2 Provided?	N/A		
		N/A	X Walk 2 Direction	To S	N/A	DWS 2 Contrast?	N/A		
		N/A	X Walk 2 Width (In)	110.0	N/A	DWS 2 Length (In)	N/A		
		N/A	Road 2 Slope (%)	2.2	N/A	DWS 2 Full Width?	N/A		
		N/A	Road 2 X Slope (%)	2.5	N/A	DWS 2 Offset (In)	N/A		
			Yes	Refuge 3 Length (in)	45.0	N/A	Gutter 3 Ponding?	N/A	
		Yes	Refuge 3 Width (in)	72.0	N/A	Gutter 3 Lip Ht (in)	N/A		
		Yes	Refuge 3 Slope (%)	1.1	N/A	Gutter 3 Slope (%)	N/A		
		Yes	Refuge 3 XSlope (%)	3.8	N/A	Gutter 3 XSlope (%)	N/A		
		N/A	Painted X Walk3?	Yes	N/A	DWS 3 Provided?	N/A		
		N/A	X Walk 3 Direction	To NE	N/A	DWS 3 Contrast?	N/A		
		N/A	X Walk 3 Width (in)	118.0	N/A	DWS 3 Length (in)	N/A		
		N/A	Road 3 Slope (%)	2.1	N/A	DWS 3 Full Width?	N/A		
		N/A	Road 3 XSlope (%)	0.9	N/A	DWS 3 Offset (in)	N/A		
		Yes	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
		N/A	Obstruction Type		N/A	Storm Grate/Utility Type			
					N/A		N/A		
		N/A	Surface Condition	Good					

