


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

| | | | |
|---|------------------------------------|---|------------------------|
| Intersection ID: 7025 | Main Street: HUTCHISON-MCDONALD_RD | Cross Street: STATESVILLE_RD | Location: S |
| ADA ID: 18A326BA17B9 | Curb Cut Type: MedianRefuge2 | Initial Pass/Fail: Pass | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |
| Severity Score: 15 | | | |

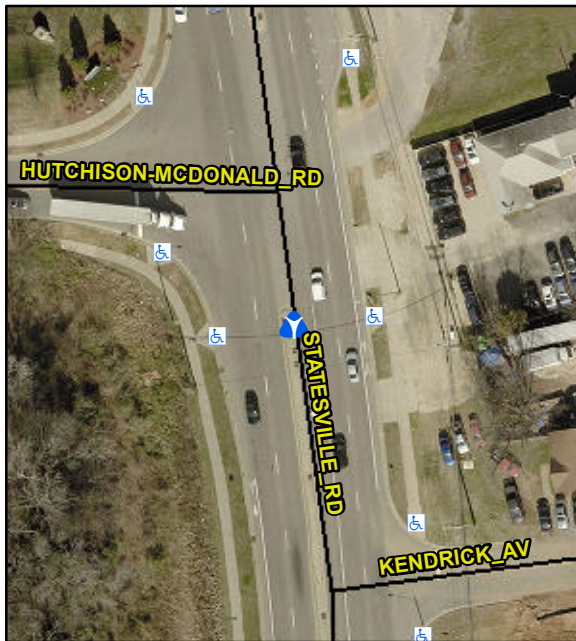

Possible Solutions:

**Remove & Replace Entire Refuge.
Fix Gutter Ponding. Grind Gutter
Lip.**

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost: \$ 3700.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|------|------------|-----------------------------|------|
| No | Refuge 1 Length (In) | 35.0 | No | Gutter 1 Ponding? | Yes |
| Yes | Refuge 1 Width (In) | 95.0 | No | Gutter 1 Lip Ht (In) | 1.0 |
| Yes | Refuge 1 Slope (%) | 1.2 | Yes | Gutter 1 Slope (%) | 2.2 |
| Yes | Refuge 1 X Slope (%) | 0.1 | Yes | Gutter 1 X Slope (%) | 2.3 |
| N/A | Painted X Walk1? | No | No | DWS 1 Provided? | Yes |
| N/A | X Walk 1 Direction | To E | N/A | DWS 1 Contrast? | Yes |
| N/A | X Walk 1 Width (In) | N/A | N/A | DWS 1 Length (In) | 24.0 |
| N/A | Road 1 Slope (%) | 1.8 | N/A | DWS 1 Full Width? | Yes |
| N/A | Road 1 X Slope (%) | 0.9 | N/A | DWS 1 Offset (In) | 0.0 |
| No | Refuge 2 Length (In) | 35.0 | No | Gutter 2 Ponding? | Yes |
| Yes | Refuge 2 Width (In) | 95.0 | Yes | Gutter 2 Lip Ht (In) | 0.0 |
| Yes | Refuge 2 Slope (%) | 1.4 | Yes | Gutter 2 Slope (%) | 4.5 |
| Yes | Refuge 2 X Slope (%) | 0.7 | Yes | Gutter 2 X Slope (%) | 0.2 |
| N/A | Painted X Walk2? | No | No | DWS 2 Provided? | Yes |
| N/A | X Walk 2 Direction | To W | N/A | DWS 2 Contrast? | Yes |
| N/A | X Walk 2 Width (In) | N/A | N/A | DWS 2 Length (In) | 24.0 |
| N/A | Road 2 Slope (%) | 0.2 | N/A | DWS 2 Full Width? | Yes |
| N/A | Road 2 X Slope (%) | 3.4 | N/A | DWS 2 Offset (In) | 0.0 |
| N/A | Refuge 3 Length (in) | N/A | N/A | Gutter 3 Ponding? | No |
| N/A | Refuge 3 Width (in) | N/A | N/A | Gutter 3 Lip Ht (in) | N/A |
| N/A | Refuge 3 Slope (%) | N/A | N/A | Gutter 3 Slope (%) | N/A |
| N/A | Refuge 3 XSlope (%) | N/A | N/A | Gutter 3 XSlope (%) | N/A |
| N/A | Painted X Walk3? | No | N/A | DWS 3 Provided? | N/A |
| N/A | X Walk 3 Direction | N/A | N/A | DWS 3 Contrast? | N/A |
| N/A | X Walk 3 Width (in) | N/A | N/A | DWS 3 Length (in) | N/A |
| N/A | Road 3 Slope (%) | N/A | N/A | DWS 3 Full Width? | N/A |
| N/A | Road 3 XSlope (%) | N/A | N/A | DWS 3 Offset (in) | N/A |
| Yes | Any Obstructions? | No | N/A | Storm Grate/Utility Hazard? | No |
| N/A | Obstruction Type | | N/A | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| N/A | Surface Condition | Good | | | |

