


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 7770	Main Street: E_ARROWHEAD_DR	Cross Street: N_TRYON_ST	Location:	S
ADA ID: 320B7040F369	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

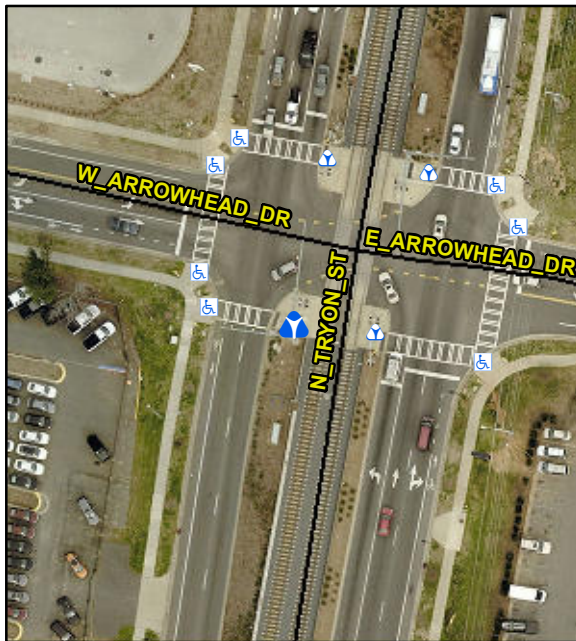

Possible Solutions:

Remove & Replace Detectable Warning System. Grind Gutter Lip. Utility Present.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost: \$ 6000.00

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	96.0	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	120.0	No	Gutter 1 Lip Ht (In)	1.0
Yes	Refuge 1 Slope (%)	1.1	Yes	Gutter 1 Slope (%)	3.8
Yes	Refuge 1 X Slope (%)	0.6	Yes	Gutter 1 X Slope (%)	0.4
N/A	Painted X Walk1?	Yes	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To W	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	119.0	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	1.2	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	2.3	No	DWS 1 Offset (In)	5.0
Yes	Refuge 2 Length (In)	109.0	Yes	Gutter 2 Ponding?	No
Yes	Refuge 2 Width (In)	120.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	0.3	Yes	Gutter 2 Slope (%)	4.0
Yes	Refuge 2 X Slope (%)	0.2	Yes	Gutter 2 X Slope (%)	1.3
N/A	Painted X Walk2?	No	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To E	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	N/A	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	0.0	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	0.8	Yes	DWS 2 Offset (In)	0.0
N/A	Refuge 3 Length (in)	N/A	N/A	Gutter 3 Ponding?	No
N/A	Refuge 3 Width (in)	N/A	N/A	Gutter 3 Lip Ht (in)	N/A
N/A	Refuge 3 Slope (%)	N/A	N/A	Gutter 3 Slope (%)	N/A
N/A	Refuge 3 XSlope (%)	N/A	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	No	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	N/A	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	N/A	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	N/A	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	N/A	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	Yes
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
		N/A			
N/A	Surface Condition	Good			

GAS VAL R2 DWS LIP 0.5"

