


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

| | | | |
|---|-------------------------------------|---|------------------------|
| Intersection ID: 23966 | Main Street: CAROLINA PAVILION DR_N | Cross Street: SOUTH BV | Location: SW |
| ADA ID: 362CA56AB464 | Curb Cut Type: IslandRefuge3 | Initial Pass/Fail: Fail | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |
| Severity Score: 47.5 | | | |

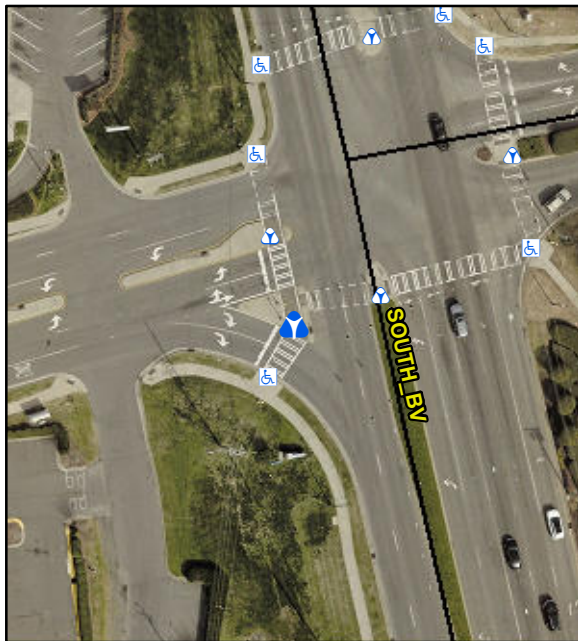

Possible Solutions:

Remove & Replace Entire Refuge.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost: \$ 3000.00



| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| Yes | Refuge 1 Length (In) | 125.0 | N/A | Gutter 1 Ponding? | N/A |
| Yes | Refuge 1 Width (In) | 118.0 | N/A | Gutter 1 Lip Ht (In) | N/A |
| Yes | Refuge 1 Slope (%) | 2.0 | N/A | Gutter 1 Slope (%) | N/A |
| Yes | Refuge 1 X Slope (%) | 3.9 | N/A | Gutter 1 X Slope (%) | N/A |
| N/A | Painted X Walk1? | Yes | N/A | DWS 1 Provided? | N/A |
| N/A | X Walk 1 Direction | To S | N/A | DWS 1 Contrast? | N/A |
| N/A | X Walk 1 Width (In) | 135.0 | N/A | DWS 1 Length (In) | N/A |
| N/A | Road 1 Slope (%) | 3.1 | N/A | DWS 1 Full Width? | N/A |
| N/A | Road 1 X Slope (%) | 0.1 | N/A | DWS 1 Offset (In) | N/A |
| Yes | Refuge 2 Length (In) | 48.0 | N/A | Gutter 2 Ponding? | N/A |
| Yes | Refuge 2 Width (In) | 71.0 | N/A | Gutter 2 Lip Ht (In) | N/A |
| Yes | Refuge 2 Slope (%) | 2.6 | N/A | Gutter 2 Slope (%) | N/A |
| Yes | Refuge 2 X Slope (%) | 1.2 | N/A | Gutter 2 X Slope (%) | N/A |
| N/A | Painted X Walk2? | Yes | N/A | DWS 2 Provided? | N/A |
| N/A | X Walk 2 Direction | To E | N/A | DWS 2 Contrast? | N/A |
| N/A | X Walk 2 Width (In) | 108.0 | N/A | DWS 2 Length (In) | N/A |
| N/A | Road 2 Slope (%) | 1.6 | N/A | DWS 2 Full Width? | N/A |
| N/A | Road 2 X Slope (%) | 0.2 | N/A | DWS 2 Offset (In) | N/A |
| Yes | Refuge 3 Length (in) | 125.0 | N/A | Gutter 3 Ponding? | N/A |
| Yes | Refuge 3 Width (in) | 118.0 | N/A | Gutter 3 Lip Ht (in) | N/A |
| No | Refuge 3 Slope (%) | 5.6 | N/A | Gutter 3 Slope (%) | N/A |
| Yes | Refuge 3 XSlope (%) | 1.5 | N/A | Gutter 3 XSlope (%) | N/A |
| N/A | Painted X Walk3? | Yes | N/A | DWS 3 Provided? | N/A |
| N/A | X Walk 3 Direction | To N | N/A | DWS 3 Contrast? | N/A |
| N/A | X Walk 3 Width (in) | 97.0 | N/A | DWS 3 Length (in) | N/A |
| N/A | Road 3 Slope (%) | 2.6 | N/A | DWS 3 Full Width? | N/A |
| N/A | Road 3 XSlope (%) | 2.8 | N/A | DWS 3 Offset (in) | N/A |
| Yes | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| N/A | Obstruction Type | | N/A | Storm Grate/Utility Type | |
| | | | N/A | | N/A |
| N/A | Surface Condition | Good | | | |