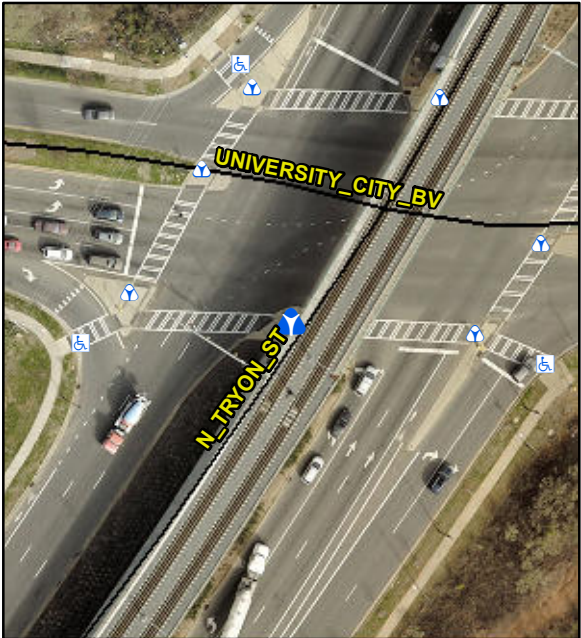


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 44555	Main Street: UNIVERSITY_CITY_BV	Cross Street: N_TRYON_ST	Location: S
ADA ID: 44A5967BFFB3	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 0.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Grind Gutter Lip.		Yes	Refuge 1 Length (In)	164.0	No
			Yes	Refuge 1 Width (In)	95.0	No
			Yes	Refuge 1 Slope (%)	4.3	Yes
			Yes	Refuge 1 X Slope (%)	1.6	Yes
			N/A	Painted X Walk1?	Yes	Yes
			N/A	X Walk 1 Direction	To W	Yes
			N/A	X Walk 1 Width (In)	124.0	Yes
			N/A	Road 1 Slope (%)	1.5	Yes
			N/A	Road 1 X Slope (%)	1.5	Yes
<p>Surveyor Notes:</p> <p>N/A</p>			Yes	Refuge 2 Length (In)	235.0	No
			Yes	Refuge 2 Width (In)	95.0	No
			Yes	Refuge 2 Slope (%)	0.3	Yes
			Yes	Refuge 2 X Slope (%)	0.6	Yes
			N/A	Painted X Walk2?	Yes	Yes
			N/A	X Walk 2 Direction	To E	Yes
			N/A	X Walk 2 Width (In)	108.0	Yes
			N/A	Road 2 Slope (%)	1.0	Yes
			N/A	Road 2 X Slope (%)	0.1	Yes
			N/A	Refuge 3 Length (in)	N/A	N/A
<p>PROW/ADA:</p> <p>N/A</p>			N/A	Refuge 3 Width (in)	N/A	N/A
			N/A	Refuge 3 Slope (%)	N/A	N/A
			N/A	Refuge 3 XSlope (%)	N/A	N/A
			N/A	Painted X Walk3?	No	N/A
			N/A	X Walk 3 Direction	N/A	N/A
			N/A	X Walk 3 Width (in)	N/A	N/A
			N/A	Road 3 Slope (%)	N/A	N/A
			N/A	Road 3 XSlope (%)	N/A	N/A
			Yes	Any Obstructions?	No	N/A
			N/A	Obstruction Type	N/A	N/A
<p>Total Cost:</p> <p>\$ 400.00</p>			N/A	Surface Condition	Good	N/A

