


# Access Compliance Report

## Public Rights-of-Way

### (Island Curb Cuts)

Intersection ID: 53624	Main Street: PROSPERITY RIDGE RD	Cross Street: RIDGE RD	Location: SW
ADA ID: 5FD040D7B12F	Curb Cut Type: IslandRefuge3	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 35			

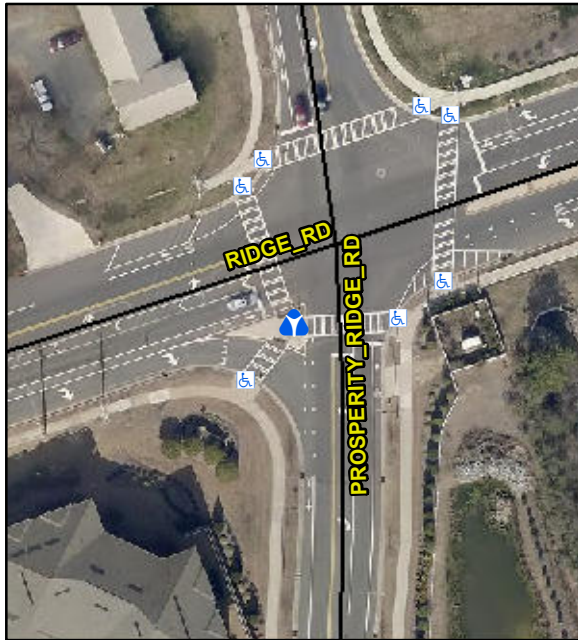

Possible Solutions:

**Remove & Replace Entire Refuge.**

Surveyor Notes:

**N/A**

PROW/ADA:

**N/A**

Total Cost:

**\$ 3000.00**



Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	56.0	N/A	Gutter 1 Ponding?	N/A
Yes	Refuge 1 Width (In)	94.5	N/A	Gutter 1 Lip Ht (In)	N/A
Yes	Refuge 1 Slope (%)	1.7	N/A	Gutter 1 Slope (%)	N/A
Yes	Refuge 1 X Slope (%)	2.9	N/A	Gutter 1 X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	DWS 1 Provided?	N/A
N/A	X Walk 1 Direction	To N	N/A	DWS 1 Contrast?	N/A
N/A	X Walk 1 Width (In)	112.0	N/A	DWS 1 Length (In)	N/A
N/A	Road 1 Slope (%)	2.8	N/A	DWS 1 Full Width?	N/A
N/A	Road 1 X Slope (%)	0.2	N/A	DWS 1 Offset (In)	N/A
Yes	Refuge 2 Length (In)	78.0	N/A	Gutter 2 Ponding?	N/A
Yes	Refuge 2 Width (In)	96.0	N/A	Gutter 2 Lip Ht (In)	N/A
Yes	Refuge 2 Slope (%)	1.2	N/A	Gutter 2 Slope (%)	N/A
Yes	Refuge 2 X Slope (%)	2.4	N/A	Gutter 2 X Slope (%)	N/A
N/A	Painted X Walk2?	Yes	N/A	DWS 2 Provided?	N/A
N/A	X Walk 2 Direction	To SW	N/A	DWS 2 Contrast?	N/A
N/A	X Walk 2 Width (In)	112.0	N/A	DWS 2 Length (In)	N/A
N/A	Road 2 Slope (%)	1.2	N/A	DWS 2 Full Width?	N/A
N/A	Road 2 X Slope (%)	2.3	N/A	DWS 2 Offset (In)	N/A
Yes	Refuge 3 Length (in)	53.0	N/A	Gutter 3 Ponding?	N/A
Yes	Refuge 3 Width (in)	94.0	N/A	Gutter 3 Lip Ht (in)	N/A
Yes	Refuge 3 Slope (%)	0.8	N/A	Gutter 3 Slope (%)	N/A
Yes	Refuge 3 XSlope (%)	0.9	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	Yes	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	To E	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	113.0	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	1.2	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	1.9	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
N/A	Surface Condition	Good	N/A		N/A