


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 44555	Main Street: UNIVERSITY_CITY_BV	Cross Street: N_TRYON_ST	Location: SE
ADA ID: 91F4A1006D08	Curb Cut Type: IslandRefuge3	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

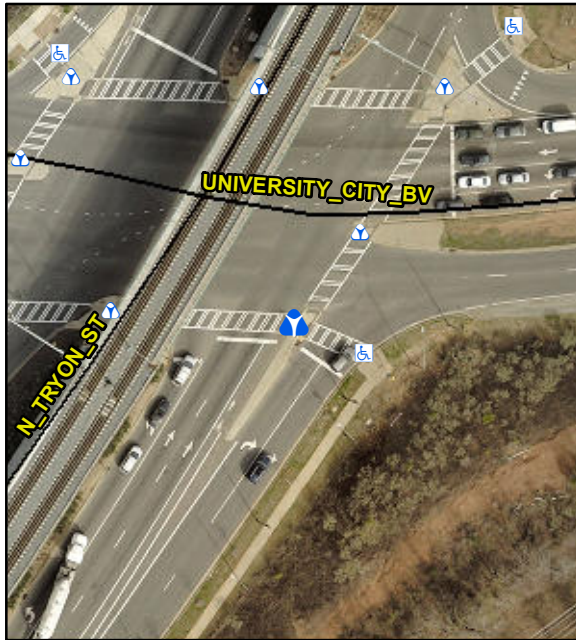

Possible Solutions:

Remove & Replace Detectable Warning System. Fix Gutter Ponding. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost: \$ 2800.00



Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	19.5	No	Gutter 1 Ponding?	Yes
Yes	Refuge 1 Width (In)	95.0	Yes	Gutter 1 Lip Ht (In)	0.0
Yes	Refuge 1 Slope (%)	2.3	Yes	Gutter 1 Slope (%)	2.8
Yes	Refuge 1 X Slope (%)	0.1	Yes	Gutter 1 X Slope (%)	1.4
N/A	Painted X Walk1?	Yes	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To W	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	115.0	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	0.1	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	2.3	No	DWS 1 Offset (In)	7.0
Yes	Refuge 2 Length (In)	77.0	No	Gutter 2 Ponding?	Yes
Yes	Refuge 2 Width (In)	95.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	1.9	Yes	Gutter 2 Slope (%)	2.5
Yes	Refuge 2 X Slope (%)	1.5	Yes	Gutter 2 X Slope (%)	0.6
N/A	Painted X Walk2?	Yes	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To N	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	118.0	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	1.8	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	2.0	Yes	DWS 2 Offset (In)	0.0
Yes	Refuge 3 Length (in)	15.0	No	Gutter 3 Ponding?	Yes
Yes	Refuge 3 Width (in)	71.0	No	Gutter 3 Lip Ht (in)	1.5
Yes	Refuge 3 Slope (%)	2.9	Yes	Gutter 3 Slope (%)	0.4
Yes	Refuge 3 XSlope (%)	0.0	Yes	Gutter 3 XSlope (%)	1.0
N/A	Painted X Walk3?	Yes	Yes	DWS 3 Provided?	Yes
N/A	X Walk 3 Direction	To SE	Yes	DWS 3 Contrast?	Yes
N/A	X Walk 3 Width (in)	118.0	Yes	DWS 3 Length (in)	24.0
N/A	Road 3 Slope (%)	0.0	No	DWS 3 Full Width?	No
N/A	Road 3 XSlope (%)	0.6	Yes	DWS 3 Offset (in)	0.0
Yes	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type	N/A	N/A	Storm Grate/Utility Type	N/A
N/A	Surface Condition	Good			