

Access Compliance Report


Public Rights-of-Way

(Island Curb Cuts)

| | | | |
|---------------------------|-------------------------------|-------------------------|-------------------------|
| Intersection ID: 10020762 | Main Street: BEATTIES_FORD_RD | Cross Street: N/A | Location: N |
| ADA ID: 99D73C428011 | Curb Cut Type: MedianRefuge2 | Initial Pass/Fail: Pass | Overall Compliance: Yes |
| | | | Severity Score: 0.25 |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

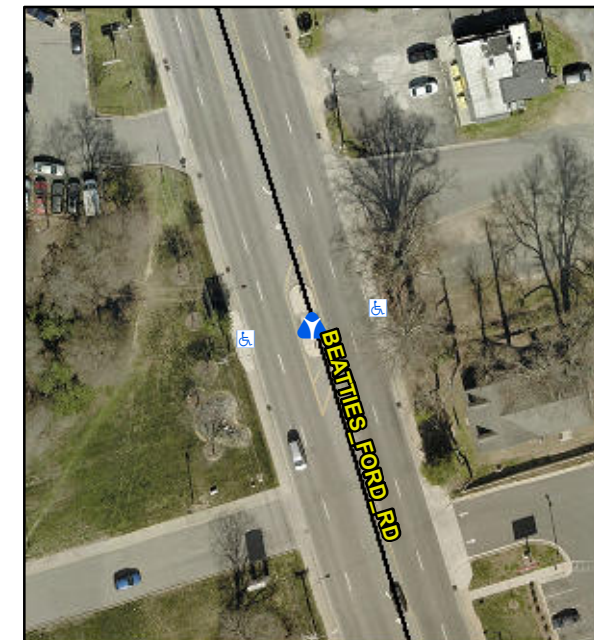

Possible Solutions:

N/A

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost:

\$ 0.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| Yes | Refuge 1 Length (In) | 71.5 | Yes | Gutter 1 Ponding? | No |
| Yes | Refuge 1 Width (In) | 107.0 | Yes | Gutter 1 Lip Ht (In) | 0.0 |
| Yes | Refuge 1 Slope (%) | 2.3 | Yes | Gutter 1 Slope (%) | 1.3 |
| Yes | Refuge 1 X Slope (%) | 0.1 | Yes | Gutter 1 X Slope (%) | 1.1 |
| N/A | Painted X Walk1? | No | Yes | DWS 1 Provided? | Yes |
| N/A | X Walk 1 Direction | To NE | Yes | DWS 1 Contrast? | Yes |
| N/A | X Walk 1 Width (In) | N/A | Yes | DWS 1 Length (In) | 24.0 |
| N/A | Road 1 Slope (%) | 0.5 | Yes | DWS 1 Full Width? | Yes |
| N/A | Road 1 X Slope (%) | 1.8 | Yes | DWS 1 Offset (In) | 0.0 |
| Yes | Refuge 2 Length (In) | 71.5 | Yes | Gutter 2 Ponding? | No |
| Yes | Refuge 2 Width (In) | 107.0 | Yes | Gutter 2 Lip Ht (In) | 0.0 |
| Yes | Refuge 2 Slope (%) | 2.5 | Yes | Gutter 2 Slope (%) | 3.2 |
| Yes | Refuge 2 X Slope (%) | 1.1 | Yes | Gutter 2 X Slope (%) | 1.2 |
| N/A | Painted X Walk2? | No | Yes | DWS 2 Provided? | Yes |
| N/A | X Walk 2 Direction | To SW | Yes | DWS 2 Contrast? | Yes |
| N/A | X Walk 2 Width (In) | N/A | Yes | DWS 2 Length (In) | 24.0 |
| N/A | Road 2 Slope (%) | 0.9 | Yes | DWS 2 Full Width? | Yes |
| N/A | Road 2 X Slope (%) | 2.6 | Yes | DWS 2 Offset (In) | 0.0 |
| N/A | Refuge 3 Length (in) | N/A | N/A | Gutter 3 Ponding? | N/A |
| N/A | Refuge 3 Width (in) | N/A | N/A | Gutter 3 Lip Ht (in) | N/A |
| N/A | Refuge 3 Slope (%) | N/A | N/A | Gutter 3 Slope (%) | N/A |
| N/A | Refuge 3 XSlope (%) | N/A | N/A | Gutter 3 XSlope (%) | N/A |
| N/A | Painted X Walk3? | N/A | N/A | DWS 3 Provided? | N/A |
| N/A | X Walk 3 Direction | N/A | N/A | DWS 3 Contrast? | N/A |
| N/A | X Walk 3 Width (in) | N/A | N/A | DWS 3 Length (in) | N/A |
| N/A | Road 3 Slope (%) | N/A | N/A | DWS 3 Full Width? | N/A |
| N/A | Road 3 XSlope (%) | N/A | N/A | DWS 3 Offset (in) | N/A |
| Yes | Any Obstructions? | No | N/A | Storm Grate/Utility Hazard? | No |
| N/A | Obstruction Type | | N/A | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| N/A | Surface Condition | Good | | | |

