


# Access Compliance Report

## Public Rights-of-Way

### (Island Curb Cuts)

Intersection ID: 8739	Main Street: N_TRYON_ST	Cross Street: W_EASTWAY_DR	Location:	SW
ADA ID: AC14DFA9C5CF	Curb Cut Type: IslandRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

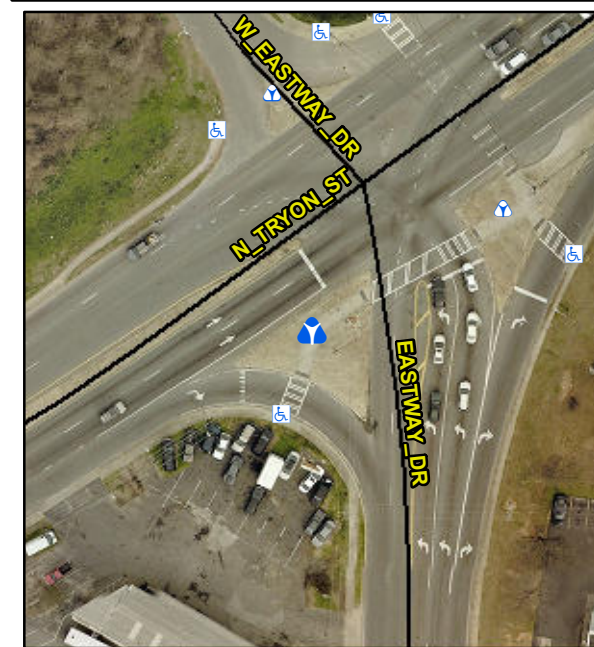

Possible Solutions:

**Grind Gutter Lip. Utility Present.**

Surveyor Notes:

**N/A**

PROW/ADA:

**N/A**

Total Cost: \$ 5200.00

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	363.5	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	92.0	No	Gutter 1 Lip Ht (In)	0.5
Yes	Refuge 1 Slope (%)	0.9	Yes	Gutter 1 Slope (%)	0.0
Yes	Refuge 1 X Slope (%)	1.1	Yes	Gutter 1 X Slope (%)	0.7
N/A	Painted X Walk1?	Yes	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To NE	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	104.5	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	1.3	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	1.5	Yes	DWS 1 Offset (In)	0.0
Yes	Refuge 2 Length (In)	280.0	Yes	Gutter 2 Ponding?	No
Yes	Refuge 2 Width (In)	91.5	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	1.3	Yes	Gutter 2 Slope (%)	2.4
Yes	Refuge 2 X Slope (%)	1.4	Yes	Gutter 2 X Slope (%)	3.4
N/A	Painted X Walk2?	Yes	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To SW	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	109.0	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	2.5	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	0.5	Yes	DWS 2 Offset (In)	0.0
N/A	Refuge 3 Length (in)	N/A	N/A	Gutter 3 Ponding?	N/A
N/A	Refuge 3 Width (in)	N/A	N/A	Gutter 3 Lip Ht (in)	N/A
N/A	Refuge 3 Slope (%)	N/A	N/A	Gutter 3 Slope (%)	N/A
N/A	Refuge 3 XSlope (%)	N/A	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	N/A	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	N/A	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	N/A	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	N/A	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	N/A	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	No	N/A	Storm Grate/Utility Hazard?	Yes
N/A	Obstruction Type	N/A	N/A	Storm Grate/Utility Type	
N/A	Surface Condition	Good	N/A	R1 WTR VAL/MANHOLE, R2 MANHOLE	

