


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

| | | | |
|---|------------------------------|---|------------------------|
| Intersection ID: 5714 | Main Street: JOHN_KIRK_DR | Cross Street: UNIVERSITY_CITY_BV | Location: S |
| ADA ID: C1B9F0C9CDF4 | Curb Cut Type: IslandRefuge3 | Initial Pass/Fail: Pass | Overall Compliance: No |
| Severity Score: 17.5 | | | |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |

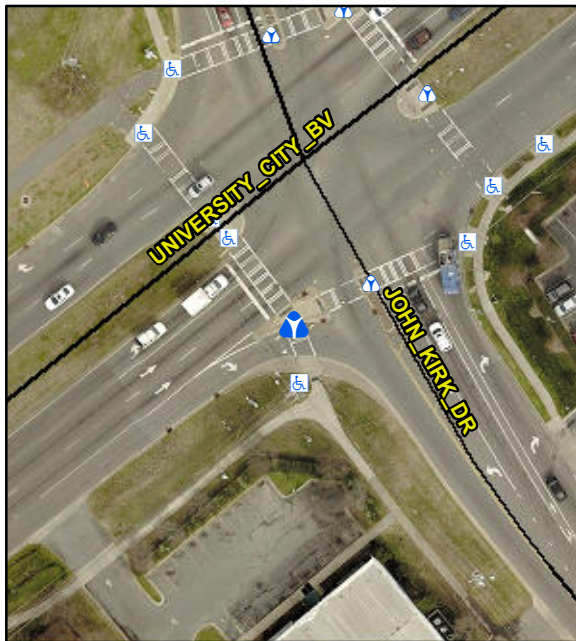

Possible Solutions:

Remove & Replace Detectable Warning System. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost: \$ 3000.00



| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| Yes | Refuge 1 Length (In) | 40.0 | No | Gutter 1 Ponding? | Yes |
| Yes | Refuge 1 Width (In) | 100.0 | No | Gutter 1 Lip Ht (In) | 0.5 |
| Yes | Refuge 1 Slope (%) | 0.4 | Yes | Gutter 1 Slope (%) | 1.7 |
| Yes | Refuge 1 X Slope (%) | 1.4 | Yes | Gutter 1 X Slope (%) | 0.6 |
| N/A | Painted X Walk1? | Yes | Yes | DWS 1 Provided? | Yes |
| N/A | X Walk 1 Direction | To S | Yes | DWS 1 Contrast? | Yes |
| N/A | X Walk 1 Width (In) | 111.0 | Yes | DWS 1 Length (In) | 24.0 |
| N/A | Road 1 Slope (%) | 1.8 | No | DWS 1 Full Width? | No |
| N/A | Road 1 X Slope (%) | 1.1 | Yes | DWS 1 Offset (In) | 0.0 |
| Yes | Refuge 2 Length (In) | 40.0 | Yes | Gutter 2 Ponding? | No |
| Yes | Refuge 2 Width (In) | 118.0 | No | Gutter 2 Lip Ht (In) | 0.5 |
| Yes | Refuge 2 Slope (%) | 0.8 | Yes | Gutter 2 Slope (%) | 2.0 |
| Yes | Refuge 2 X Slope (%) | 0.4 | Yes | Gutter 2 X Slope (%) | 1.1 |
| N/A | Painted X Walk2? | Yes | Yes | DWS 2 Provided? | Yes |
| N/A | X Walk 2 Direction | To NW | Yes | DWS 2 Contrast? | Yes |
| N/A | X Walk 2 Width (In) | 111.0 | Yes | DWS 2 Length (In) | 24.0 |
| N/A | Road 2 Slope (%) | 1.1 | No | DWS 2 Full Width? | No |
| N/A | Road 2 X Slope (%) | 1.1 | Yes | DWS 2 Offset (In) | 0.0 |
| Yes | Refuge 3 Length (in) | 176.0 | No | Gutter 3 Ponding? | Yes |
| Yes | Refuge 3 Width (in) | 101.0 | No | Gutter 3 Lip Ht (in) | .25 |
| Yes | Refuge 3 Slope (%) | 1.3 | Yes | Gutter 3 Slope (%) | 1.5 |
| Yes | Refuge 3 XSlope (%) | 1.0 | Yes | Gutter 3 XSlope (%) | 0.3 |
| N/A | Painted X Walk3? | Yes | Yes | DWS 3 Provided? | Yes |
| N/A | X Walk 3 Direction | To NE | Yes | DWS 3 Contrast? | Yes |
| N/A | X Walk 3 Width (in) | 111.0 | Yes | DWS 3 Length (in) | 24.0 |
| N/A | Road 3 Slope (%) | 0.1 | No | DWS 3 Full Width? | No |
| N/A | Road 3 XSlope (%) | 2.1 | Yes | DWS 3 Offset (in) | 0.0 |
| Yes | Any Obstructions? | No | N/A | Storm Grate/Utility Hazard? | No |
| N/A | Obstruction Type | | N/A | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| N/A | Surface Condition | Good | | | |