


Access Compliance Report

Public Rights-of-Way

(Island Curb Cuts)

Intersection ID: 28291	Main Street: COMMUNITY HOUSE RD	Cross Street: ARDREY KELL RD	Location: SE
ADA ID: E2894B18C6C2	Curb Cut Type: IslandRefuge3	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

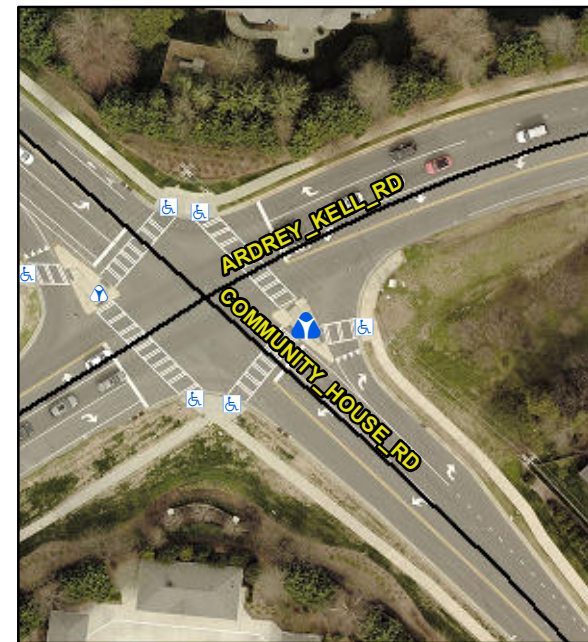

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

N/A

Total Cost: \$ 2400.00



Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	66.5	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	73.0	Yes	Gutter 1 Lip Ht (In)	0.0
Yes	Refuge 1 Slope (%)	2.2	Yes	Gutter 1 Slope (%)	0.1
Yes	Refuge 1 X Slope (%)	1.7	Yes	Gutter 1 X Slope (%)	1.4
N/A	Painted X Walk1?	Yes	Yes	DWS 1 Provided?	Yes
N/A	X Walk 1 Direction	To SW	Yes	DWS 1 Contrast?	Yes
N/A	X Walk 1 Width (In)	112.0	Yes	DWS 1 Length (In)	24.0
N/A	Road 1 Slope (%)	2.3	Yes	DWS 1 Full Width?	Yes
N/A	Road 1 X Slope (%)	1.2	No	DWS 1 Offset (In)	6.0
Yes	Refuge 2 Length (In)	79.0	Yes	Gutter 2 Ponding?	No
Yes	Refuge 2 Width (In)	72.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	2.9	Yes	Gutter 2 Slope (%)	2.6
Yes	Refuge 2 X Slope (%)	0.7	Yes	Gutter 2 X Slope (%)	2.0
N/A	Painted X Walk2?	Yes	Yes	DWS 2 Provided?	Yes
N/A	X Walk 2 Direction	To NW	Yes	DWS 2 Contrast?	Yes
N/A	X Walk 2 Width (In)	112.0	Yes	DWS 2 Length (In)	24.0
N/A	Road 2 Slope (%)	2.1	Yes	DWS 2 Full Width?	Yes
N/A	Road 2 X Slope (%)	2.6	No	DWS 2 Offset (In)	18.0
Yes	Refuge 3 Length (in)	62.0	Yes	Gutter 3 Ponding?	No
Yes	Refuge 3 Width (in)	76.0	Yes	Gutter 3 Lip Ht (in)	0.0
Yes	Refuge 3 Slope (%)	1.4	Yes	Gutter 3 Slope (%)	2.0
Yes	Refuge 3 XSlope (%)	0.9	Yes	Gutter 3 XSlope (%)	0.2
N/A	Painted X Walk3?	Yes	Yes	DWS 3 Provided?	Yes
N/A	X Walk 3 Direction	To NE	Yes	DWS 3 Contrast?	Yes
N/A	X Walk 3 Width (in)	110.0	Yes	DWS 3 Length (in)	24.0
N/A	Road 3 Slope (%)	0.2	Yes	DWS 3 Full Width?	Yes
N/A	Road 3 XSlope (%)	1.7	No	DWS 3 Offset (in)	4.0
Yes	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type	N/A	N/A	Storm Grate/Utility Type	N/A
N/A	Surface Condition	Good			