


Access Compliance Report Public Rights-of-Way (Island Curb Cuts)

Intersection ID: 10025446	Main Street: E_INDEPENDENCE_BV	Cross Street: N/A	Location: E
ADA ID: FE8111C1248B	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

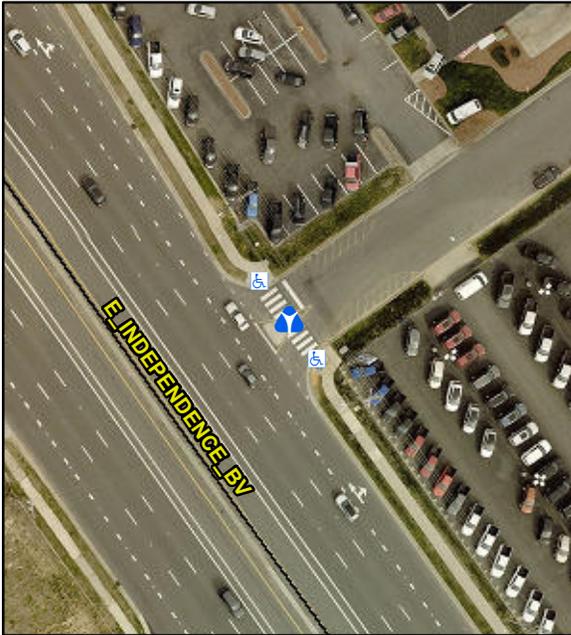

Possible Solutions:
**Remove & Replace Entire Refuge.
Remove & Replace Gutter.**

Surveyor Notes:
N/A

PROW/ADA:
N/A

Total Cost: \$ **3750.00**

Compliance	Description	Data	Compliance	Description	Data
No	Refuge 1 Length (In)	27.0	Yes	Gutter 1 Ponding?	No
Yes	Refuge 1 Width (In)	74.0	Yes	Gutter 1 Lip Ht (In)	0.0
Yes	Refuge 1 Slope (%)	0.4	Yes	Gutter 1 Slope (%)	3.6
Yes	Refuge 1 X Slope (%)	0.3	No	Gutter 1 X Slope (%)	2.2
N/A	Painted X Walk1?	Yes	Yes	DWS 1 Provided?	No
N/A	X Walk 1 Direction	To NW	N/A	DWS 1 Contrast?	N/A
N/A	X Walk 1 Width (In)	119.5	N/A	DWS 1 Length (In)	N/A
N/A	Road 1 Slope (%)	0.6	N/A	DWS 1 Full Width?	N/A
N/A	Road 1 X Slope (%)	1.1	N/A	DWS 1 Offset (In)	N/A
No	Refuge 2 Length (In)	27.0	Yes	Gutter 2 Ponding?	No
Yes	Refuge 2 Width (In)	74.0	Yes	Gutter 2 Lip Ht (In)	0.0
Yes	Refuge 2 Slope (%)	0.6	Yes	Gutter 2 Slope (%)	3.0
Yes	Refuge 2 X Slope (%)	1.6	Yes	Gutter 2 X Slope (%)	1.3
N/A	Painted X Walk2?	Yes	Yes	DWS 2 Provided?	No
N/A	X Walk 2 Direction	To SE	N/A	DWS 2 Contrast?	N/A
N/A	X Walk 2 Width (In)	119.0	N/A	DWS 2 Length (In)	N/A
N/A	Road 2 Slope (%)	1.0	N/A	DWS 2 Full Width?	N/A
N/A	Road 2 X Slope (%)	1.1	N/A	DWS 2 Offset (In)	N/A
N/A	Refuge 3 Length (in)	N/A	N/A	Gutter 3 Ponding?	N/A
N/A	Refuge 3 Width (in)	N/A	N/A	Gutter 3 Lip Ht (in)	N/A
N/A	Refuge 3 Slope (%)	N/A	N/A	Gutter 3 Slope (%)	N/A
N/A	Refuge 3 XSlope (%)	N/A	N/A	Gutter 3 XSlope (%)	N/A
N/A	Painted X Walk3?	N/A	N/A	DWS 3 Provided?	N/A
N/A	X Walk 3 Direction	N/A	N/A	DWS 3 Contrast?	N/A
N/A	X Walk 3 Width (in)	N/A	N/A	DWS 3 Length (in)	N/A
N/A	Road 3 Slope (%)	N/A	N/A	DWS 3 Full Width?	N/A
N/A	Road 3 XSlope (%)	N/A	N/A	DWS 3 Offset (in)	N/A
Yes	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	No
N/A	Obstruction Type		N/A	Storm Grate/Utility Type	
			N/A		N/A
N/A	Surface Condition	Good			

