Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

Intersection ID: 12492 **Main Street:** S_COLLEGE_ST **Cross Street:** E_4TH_ST **Location:** N

ADA ID: 2AF83F02AD65 **Ramp Type:** BlendTrans1 **Initial Pass/Fail:** Pass **Overall Compliance:** No **Severity Score:** 7.75

Codes/Mitigation Info/Possible Solution

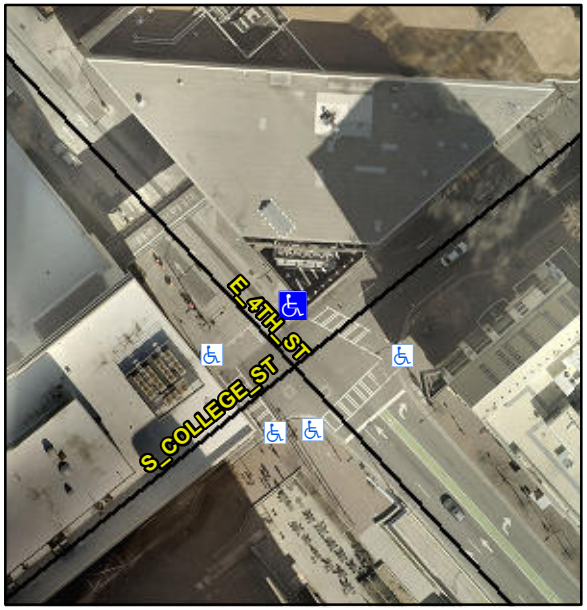

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk(s) To Provide Clear space. Grind Gutter Lip. Utility Present.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.1, Not Found, R305.2, R302.7.2, R302.3, R402.2

Street 1 Name	E 4TH ST
Stop Condition-Street 1	Signal
Street 2 Name	S COLLEGE ST
Stop Condition-Street 2	Signal

Total Cost: $ 8900.00

Field Measurements/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	36.0	Yes	BlendTrans Slope (%)	0.6
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	3.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	4.2	Yes	Flare Slope RT (%)	3.4
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	0.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	4.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	119.0		X Walk 2 Width (in)	119.0
	X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	0.2
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.1		Clear Space?	No
	Road X Slope (%)	0.2	No	Clear Space to XWalk (in)	24.0
Yes	Any Obstructions?	No	No	Storm Grate/Utility Hazard?	Yes
	Obstruction Type			Storm Grate/Utility Type	
		N/A			MH
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.3