Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

cole CHARLOTTE

Intersection ID: 17205	**Main Street: LINDA_LN**	**Cross Street: WALKER_RD**	**Location: SW**
ADA ID: 95BD4BC4749D	**Ramp Type: ParaDiag**	**Initial Pass/Fail: Pass** **Overall Compliance: No**	**Severity Score: 4**

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
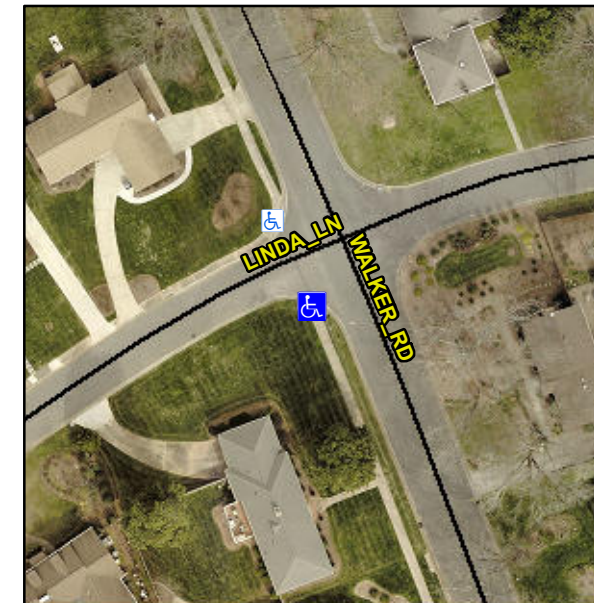
Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

ASP LIP 0.5, RT RP < 5%

PROW/ADA:

Not Found, R304.2.1, R305.2

Total Cost: $ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	58.0	N/A	Ramp Length RT (in)	63.0
Yes	Ramp Width LT (in)	49.0	Yes	Ramp Width RT (in)	49.0
Yes	Ramp Slope LT (%)	6.6	Yes	Ramp Slope RT (%)	4.2
Yes	Ramp XSlope LT (%)	0.2	Yes	Ramp XSlope RT (%)	2.0
No	Landing Length (in)	47.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	41.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	0.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.7	N/A	Clear Space?	Yes
	Road X Slope (%)	7.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			Replace Curb Ramp Slope (%)		14.7

Street 1 Name	**WALKER RD**
Stop Condition-Street 1	**None**
Street 2 Name	**LINDA LN**
Stop Condition-Street 2	**StopSign**