Access Compliance Report
Public Rights-of-Way
(Curb Ramps)

cole

CHARLOTTE™

Intersection ID: 11129	**Main Street: BECKWITH_PL**	**Cross Street: NEWELL_AV**	**Location: SE**
ADA ID: 96659619C51F	**Ramp Type: PerpDiag**	**Initial Pass/Fail: Pass** **Overall Compliance: No**	**Severity Score: 42.5**

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
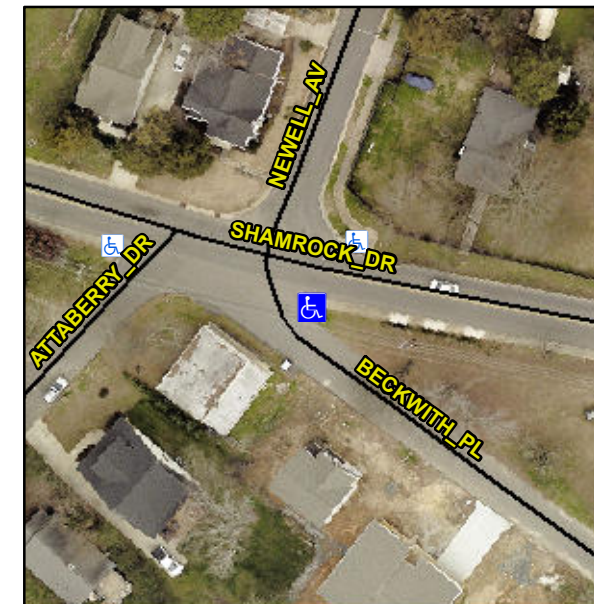
Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, R304.5.4

Street 1 Name		**BECKWITH PL**
Stop Condition-Street 2		**StopSign**
Street 2 Name		**SHAMROCK DR**
Stop Condition-Street 1		**None**

Total Cost:	$	3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	Yes	Ramp Slope (%)	7.9
No	Ramp Width (in)	24.0	No	Ramp XSlope (%)	10.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.9	N/A	Flare Slope RT (%)	10.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.5
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	6.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	14.4		X Walk 2 Slope (%)	24.3
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	4.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.4	N/A	Clear Space?	Yes
	Road X Slope (%)	9.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
	N/A				N/A
			Yes	Surface Condition? (G/P)	Good