

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12877	Main Street: E_5TH_ST	Cross Street: N_MYERS_ST	Location:	N
ADA ID: 04DE8A99824B	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

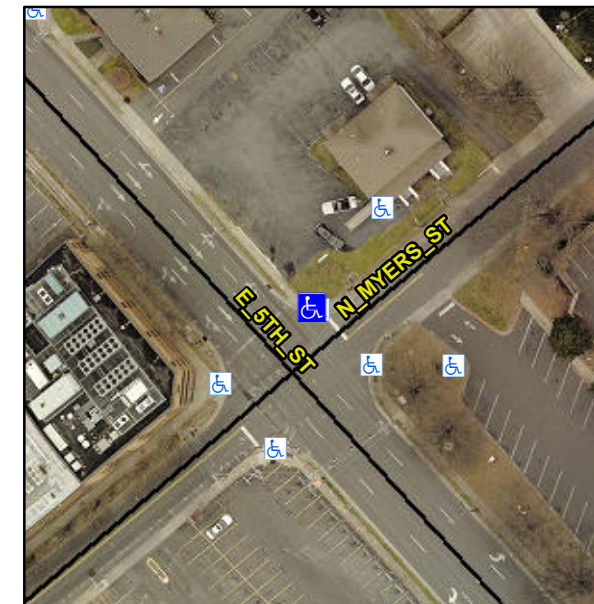

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3, R304.3.2

Total Cost:

\$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	51.0	N/A	Ramp Length RT (in)	55.0
No	Ramp Width LT (in)	34.0	No	Ramp Width RT (in)	33.0
No	Ramp Slope LT (%)	12.6	Yes	Ramp Slope RT (%)	8.1
Yes	Ramp XSlope LT (%)	0.9	No	Ramp XSlope RT (%)	5.9
N/A	Ramp Length (in)	25.0	No	Ramp Slope (%)	11.1
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	6.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	8.4		X Walk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	4.1		X Walk 2 X Slope (%)	5.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	7.2		Clear Space?	N/A
	Road X Slope (%)	3.1	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	19.4

