


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 50706Main Street:GENERATIONS_STCross Street:BROTHERLY_LNLocation:NEADA ID: 04E0204C64CCRamp Type:PerpDiagInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

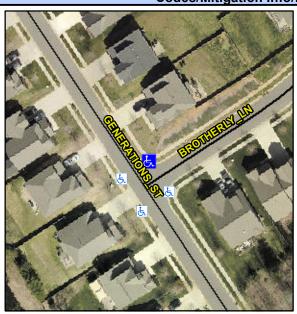

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

GENERATIONS ST None BROTHERLY LN StopSign Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.3

Total Cost: \$ 3200.00

Comp	oliance	Description	Data	Comp	oliance	Description	Data
N/A	Ramp	Length (in)	50.0		Ramp	Slope (%)	6.8
Yes	es Ramp Width (in)		48.0	No	Ram	XSlope (%)	7.5
N/A	Flare	Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare	Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare	Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landi	ng Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landi	ng Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landi	ng Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landi	ng X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landi	ng Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Share	ed Landing?	N/A				
N/A	Gutte	er Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A
N/A	Gutte	r Lip Ht (in)	N/A	N/A	Gutte	er X Slope (%)	N/A
N/A	Paint	ed X Walk1?	No	N/A	Paint	ed X Walk2?	No
	X Wa	lk 1 Direction	To SE		X Wa	lk 2 Direction	To SW
N/A	X Wa	lk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Wa	lk 1 Slope (%)	3.7		X Wa	lk 2 Slope (%)	3.6
	X Wa	lk 1 X Slope (%)	6.1		X Wa	lk 2 X Slope (%)	5.5
N/A	Ramp	inside XWalk1?	N/A	N/A	Ram	o inside XWalk2?	N/A
	Road	Slope (%)	7.4	N/A	Clear	Space?	N/A
	Road	X Slope (%)	1.9	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any C	Obstructions?	N/A	N/A	Storn	n Grate/Utility Hazard?	N/A
	Obstr	ruction Type			Storn	n Grate/Utility Type	
			N/A				N/A

Yes

Surface Condition? (G/P)

Good





