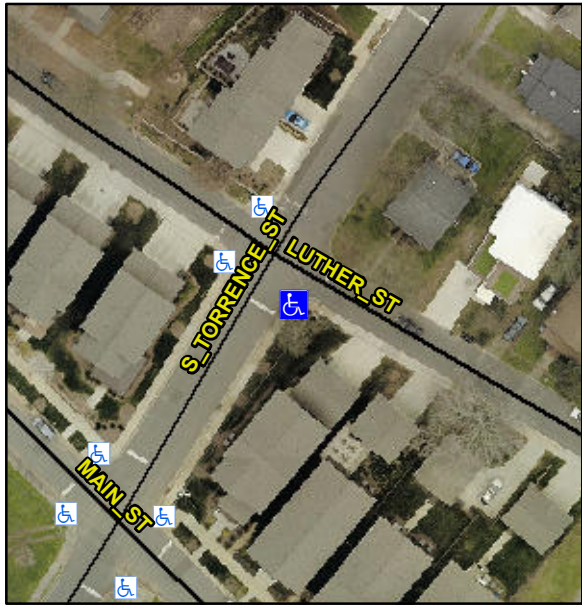


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14253	Main Street: LUTHER_ST	Cross Street: S_TORRENCE_ST	Location: SE
ADA ID: 0F743D13CCC2	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	55.0	Yes	Ramp Slope (%)	6.9
			No	Ramp Width (in)	36.0	No	Ramp XSlope (%)	7.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
	PROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	Not Found, R304.5.1, R304.5.3		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	7.8		X Walk 2 Slope (%)	1.8
				X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	8.5
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Street 1 Name LUTHER ST Stop Condition-Street 2 StopSign Street 2 Name S TORRENCE ST Stop Condition-Street 1 StopSign				Road Slope (%)	6.1	N/A	Clear Space?	N/A
				Road X Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
	Total Cost:		\$	3200.00				

