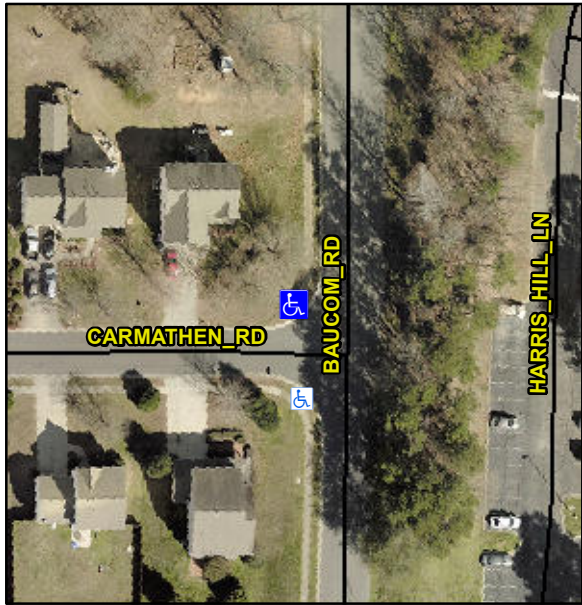


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 4938	Main Street: BAUCOM_RD	Cross Street: CARMATHEN_RD	Location: NW
ADA ID: 1225F035D092	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 31.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance								
 Street 1 Name CARMATHEN RD Stop Condition-Street 2 StopSign Street 2 Name N/A Stop Condition-Street 1 N/A			Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
			Remove & Replace Entire Ramp.			N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	8.6
						No	Ramp Width (in)	35.5	No	Ramp XSlope (%)	4.2
						N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
						N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
						N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
						N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
						N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
						N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
						N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
						N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
						N/A	Shared Landing?	N/A			
						N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
						N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
						N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
							X Walk 1 Direction	To S		X Walk 2 Direction	N/A
						N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
							X Walk 1 Slope (%)	4.1		X Walk 2 Slope (%)	N/A
							X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	N/A
						N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	N/A	N/A	Clear Space?	N/A			
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A			
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
				Obstruction Type			Storm Grate/Utility Type				
						N/A		N/A			
						Yes	Surface Condition? (G/P)	Good			
Surveyor Notes:											
N/A											
PROW/ADA:											
Not Found, R304.5.1, R304.2.2, R304.5.3											
Total Cost:			\$	1850.00							

