


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 12925 Main Street: S_CHURCH_ST Cross Street: W_CARSON_BV Location: NE **Severity Score: ADA ID: 12BB9D931D2D** Ramp Type: Directional1 Initial Pass/Fail: Fail **Overall Compliance: No** 12.5

Codes/Mitigation Info/Possible Solution

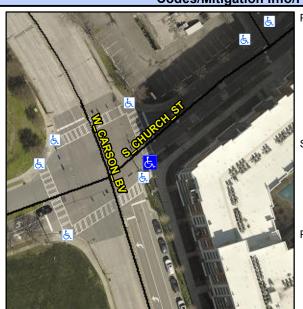

S CHURCH ST Street 1 Name Stop Condition-Street 1 Signal Street 2 Name N/A Stop Condition-Street 2 N/A

Possible Solutions:							
Remove & Replace Entire Ramp.							
Surveyor Notes:							
N/A							
PROW/ADA:							
R304.2.2							

	Yes	F
	No	F
	Yes	F
	N/A	F
	N/A	I
	N/A	F
	N/A	L
	N/A	5
	N/A	(
	N/A	(
	N/A	F
		>
		>
		>
		>
	N/A	F
	N/A	,
1600.00		(

Field Measurements/Component Compliance									
Compl	iance Description	Data	Comp	liance	Description	Data			
N/A	Ramp Length (in)	92.0	N/A	Grad	e Break?	N/A			
Yes	Ramp Width (in)	89.0	N/A	Grad	e Break Slope (%)	0.0			
No	Ramp Slope (%)	9.2	N/A	Grad	e Break XSlope (%)	0.0			
Yes	Ramp XSlope (%)	0.6							
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A			
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	0.0			
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A			
N/A	Landing Length (in)	0.0	N/A	DWS	Provided?	N/A			
N/A	Landing Width (in)	0.0	N/A	DWS	Contrast?	N/A			
N/A	Landing Slope (%)	0.0	N/A	DWS	Length (in)	N/A			
N/A	Landing X Slope (%)	0.0	N/A	DWS	Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset LT (in)	N/A			
N/A	Shared Landing?	N/A	N/A	DWS	Offset RT (in)	N/A			
N/A	Gutter Ponding?	0.0	N/A	Gutte	er Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutte	r X Slope (%)	N/A			
N/A	Painted X Walk1?	Yes		Road	Slope (%)	1.0			
	X Walk 1 Direction	To NW		Road	X Slope (%)	0.7			
	X Walk 1 Width (in)	115.0		Clear	Space?	N/A			
	X Walk 1 Slope (%)	1.0	N/A	Clear	Space to XWalk (in)	N/A			
	X Walk 1 X Slope (%)	0.7	N/A	Storn	n Grate/Utility Hazard?	N/A			
N/A	Ramp inside XWalk1?	Yes		Storn	n Grate/Utility Type				
N/A	Any Obstructions?	N/A				N/A			
	Obstruction Type		Yes	Surfa	ce Condition? (G/P)	Good			
		N/A	N/A	Curb	Slope (%)	8.9			





Total Cost:

