

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

Yes

2.0

2.9

N/A

N/A

No

Yes

Yes

24.0

No

5.0

51.0

0.0

2.8

0.0

3.3

Yes

N/A

No

N/A

Good

17.3

Intersection ID: 10033476 Main Street: OLD PINEVILLE RD **Cross Street: BARTON BV** Location: SW Initial Pass/Fail: Pass **Overall Compliance: No Severity Score: ADA ID: 15F758EEBF18** Ramp Type: Directional1 2.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

Yes

Yes

Yes

N/A

N/A

Yes

Yes

Yes

No

Yes

Yes

Yes

N/A

Yes

Yes

Compliance Description

Grade Break?

Flare Type RT

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset LT (in)

DWS Offset RT (in)

Gutter Slope (%)

Road Slope (%)

Clear Space?

Road X Slope (%)

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Curb Slope (%)

Storm Grate/Utility Hazard?

Gutter X Slope (%)

Flare Traversable RT?

Grade Break Slope (%)

Grade Break XSlope (%)

Data

112.5

69.0

2.6

3.2

N/A

N/A

No

58.0

75.0

1.5

2.8

No No

No

No

0.0

No

To N

N/A

0.0

3.3

N/A

No

N/A No


Flare Traversable LT?

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Any Obstructions?

Obstruction Type

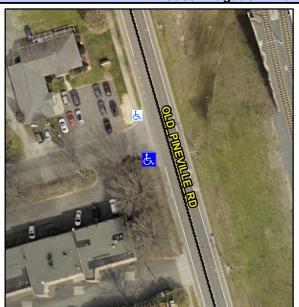

BARTON BV Street 1 Name Stop Condition-Street 1 None N/A Street 2 Name Stop Condition-Street 2 N/A

71 CCCIDIO CCIALICII		i ioia iiio
Possible Solutions:	Compl	iance Description
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)
·	Yes	Ramp Width (in)
	Yes	Ramp Slope (%)
	Yes	Ramp XSlope (%)
	Yes	Flare Type LT
	N/A	Flare Slope LT (%)
Surveyor Notes:	N/A	Flare Traversable L
N/A	Yes	Landing Length (in)
	Yes	Landing Width (in)
	Yes	Landing Slope (%)
	Yes	Landing X Slope (%
PROW/ADA:	N/A	Landing Curb? (Y/N
Not Found, R305.1.4, R305.2	N/A	Shared Landing?
	Yes	Gutter Ponding?
	Yes	Gutter Lip Ht (in)
	N/A	Painted X Walk1?
		X Walk 1 Direction
		X Walk 1 Width (in)
		X Walk 1 Slope (%)
		X Walk 1 X Slope (%

Service of the last		r00 I
100		FOR L
prop 100		704-724-
	A COLUMN TO A COLU	SO VAROCETY COS

Total Cost:



N/A

Yes

1600.00

