

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

9.1

7.3

N/A

Good

Intersection ID: 6011 Main Street: UNIVERSITY CITY BV Cross Street: MARK TWAIN RD Location: SE **Overall Compliance: No Severity Score:** ADA ID: 1DD2981046D8 Ramp Type: Perp Initial Pass/Fail: Fail 37.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

No

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Data

99.0

118.0

N/A

Yes

To SW

122.0

2.0

4.1

Yes

N/A

N/A

N/A

N/A

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?


Gutter Lip Ht (in)

Painted X Walk1?

X Walk 1 Direction

Flare Traversable LT?

Flare Type LT

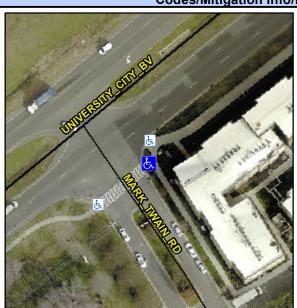

MARK TWAIN RD Street 1 Name Stop Condition-Street 2 StopSign N/A Street 2 Name Stop Condition-Street 1 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. Yes N/A N/A N/A N/A Surveyor Notes: N/A N/A N/A PROW/ADA: Not Found, R304.2.2, R304.5.3

N/A N/A N/A N/A N/A N/A N/A

X Walk 1 Width (in) X Walk 1 Slope (%) X Walk 1 X Slope (%) N/A Ramp inside XWalk1? Road Slope (%) Road X Slope (%) N/A Any Obstructions? Total Cost: **Obstruction Type** 1850.00





