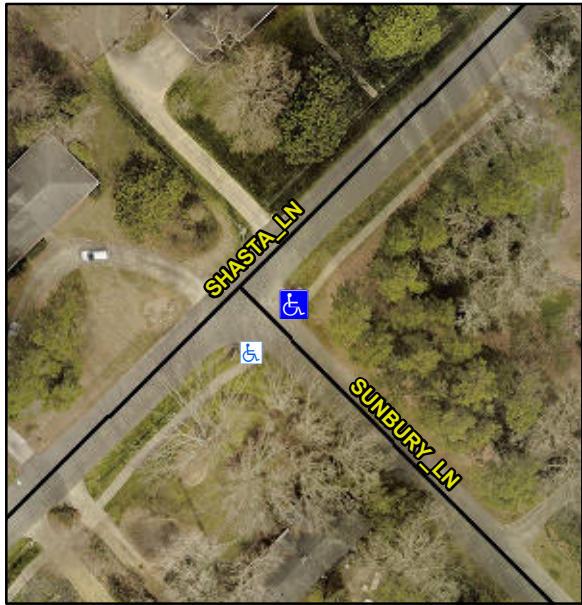


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                      |                         |                          |                        |
|----------------------|-------------------------|--------------------------|------------------------|
| Intersection ID: N/A | Main Street: SHASTA_LN  | Cross Street: SUNBURY_LN | Location: E            |
| ADA ID: 229E49134853 | Ramp Type: Directional1 | Initial Pass/Fail: Fail  | Overall Compliance: No |
|                      |                         | Severity Score: 1.25     |                        |

| Codes/Mitigation Info/Possible Solution  |                               |            | Field Measurements/Component Compliance |                       |       |            |                             |      |
|--|-------------------------------|------------|---|-----------------------|-------|------------|-----------------------------|------|
|  | Possible Solutions:           |            | Compliance                              | Description           | Data  | Compliance | Description                 | Data |
|  | Remove & Replace Entire Ramp. |            | N/A                                     | Ramp Length (in)      | 61.0  | N/A        | Grade Break?                | N/A  |
|  |                               |            | Yes                                     | Ramp Width (in)       | 48.0  | N/A        | Grade Break Slope (%)       | 0.0  |
|  |                               |            | Yes                                     | Ramp Slope (%)        | 2.3   | N/A        | Grade Break XSlope (%)      | 0.0  |
|  |                               |            | No                                      | Ramp XSlope (%)       | 3.7   |            |                             |      |
|  |                               |            | N/A                                     | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
|  |                               |            | N/A                                     | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | 0.0  |
|  |                               |            | N/A                                     | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
|  |                               |            | N/A                                     | Landing Length (in)   | 0.0   | N/A        | DWS Provided?               | N/A  |
|  |                               |            | N/A                                     | Landing Width (in)    | 0.0   | N/A        | DWS Contrast?               | N/A  |
| Surveyor Notes:  |                               |            | N/A                                     | Landing Slope (%)     | 0.0   | N/A        | DWS Length (in)             | N/A  |
| N/A  |                               |            | N/A                                     | Landing X Slope (%)   | 0.0   | N/A        | DWS Full Width?             | N/A  |
| PROW/ADA:  |                               |            | N/A                                     | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset LT (in)          | N/A  |
| R304.5.3   |                               |            | N/A                                     | Shared Landing?       | N/A   | N/A        | DWS Offset RT (in)          | N/A  |
|  |                               |            | N/A                                     | Gutter Ponding?       | 0.0   | N/A        | Gutter Slope (%)            | N/A  |
|  |                               |            | N/A                                     | Gutter Lip Ht (in)    | 0.0   | N/A        | Gutter X Slope (%)          | N/A  |
|  |                               |            | N/A                                     | Painted X Walk1?      | No    |            | Road Slope (%)              | 0.6  |
|  |                               |            |   | X Walk 1 Direction    | To SW |            | Road X Slope (%)            | 1.7  |
|  |                               |            |   | X Walk 1 Width (in)   | N/A   |            | Clear Space?                | N/A  |
|  |                               |            |   | X Walk 1 Slope (%)    | 0.6   | N/A        | Clear Space to XWalk (in)   | N/A  |
|  |                               |            |   | X Walk 1 X Slope (%)  | 1.7   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|  |                               |            | N/A                                     | Ramp inside XWalk1?   | N/A   |            | Storm Grate/Utility Type    |      |
|  |                               |            | N/A                                     | Any Obstructions?     | N/A   |            |                             | N/A  |
|  |                               |            |   | Obstruction Type      |       | Yes        | Surface Condition? (G/P)    | Good |
|  |                               |            |   |                       |       | N/A        | Curb Slope (%)              | 1.1  |
| Street 1 Name  |                               | SUNBURY LN |   |                       |       |            |                             |      |
| Stop Condition-Street 1  |                               | StopSign   |   |                       |       |            |                             |      |
| Street 2 Name  |                               | N/A        |   |                       |       |            |                             |      |
| Stop Condition-Street 2  |                               | N/A        |   |                       |       |            |                             |      |
| Total Cost:  |                               | \$ 1600.00 |   |                       |       |            |                             |      |

