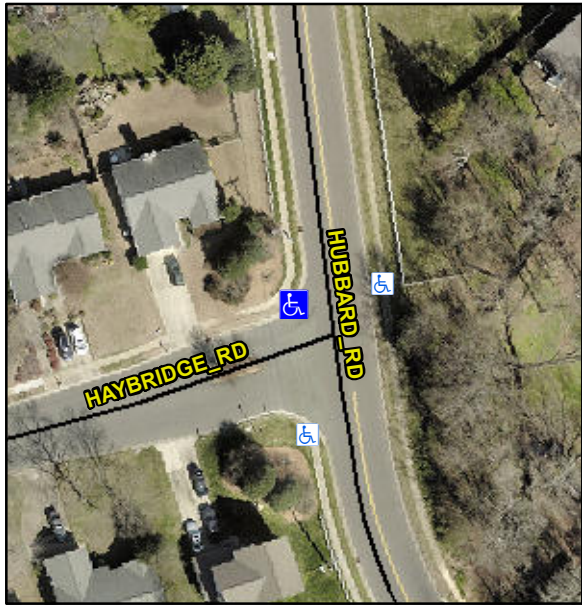


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5111	Main Street: HAYBRIDGE_RD	Cross Street: HUBBARD_RD	Location: NW
ADA ID: 254794F353DB	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <p>Street 1 Name HAYBRIDGE RD</p> <p>Stop Condition-Street 2 StopSign</p> <p>Street 2 Name HUBBARD RD</p> <p>Stop Condition-Street 1 None</p>	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	20.0
			Yes	Ramp Width (in)	50.0	No	Ramp XSlope (%)	4.7
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	N/A
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To S			X Walk 2 Direction	To E
		N/A	X Walk 1 Width (in)	N/A	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	4.5			X Walk 2 Slope (%)	2.2
			X Walk 1 X Slope (%)	4.4			X Walk 2 X Slope (%)	6.3
		N/A	Ramp inside XWalk1?	N/A	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	6.2	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	2.5	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type				Storm Grate/Utility Type	
				N/A				N/A
						Yes	Surface Condition? (G/P)	Good
Surveyor Notes:								
N/A								
PROW/ADA:								
Not Found, R304.2.2, R304.5.3								
Total Cost:		\$	3200.00					

