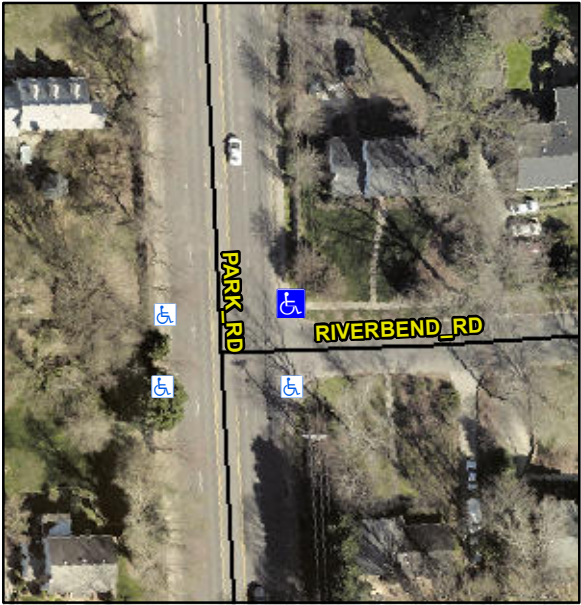


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 21939	Main Street: PARK_RD	Cross Street: RIVERBEND_RD	Location: NE
ADA ID: 2631756EB21B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 37.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>No</b>	Ramp Length (in)	80.0
			<b>Yes</b>	Ramp Width (in)	49.0
			<b>N/A</b>	Flare Type LT	N/A
			<b>N/A</b>	Flare Slope LT (%)	N/A
			<b>N/A</b>	Flare Traversable LT?	N/A
			<b>N/A</b>	Landing Length (in)	N/A
			<b>N/A</b>	Landing Width (in)	N/A
			<b>N/A</b>	Landing Slope (%)	N/A
			<b>N/A</b>	Landing X Slope (%)	N/A
			<b>N/A</b>	Landing Curb? (Y/N)	N/A
			<b>N/A</b>	Shared Landing?	N/A
			<b>N/A</b>	Gutter Ponding?	N/A
			<b>N/A</b>	Gutter Lip Ht (in)	N/A
			<b>No</b>	Painted X Walk1?	N/A
				X Walk 1 Direction	To W
			<b>N/A</b>	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.6
				X Walk 1 X Slope (%)	3.2
			<b>N/A</b>	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.2.2, R304.5.3</b></p>			<b>N/A</b>	Flare Type RT	N/A
			<b>N/A</b>	Flare Slope RT (%)	N/A
			<b>N/A</b>	Flare Traversable RT?	N/A
			<b>N/A</b>	DWS Provided?	N/A
			<b>N/A</b>	DWS Contrast?	N/A
			<b>N/A</b>	DWS Length (in)	N/A
			<b>N/A</b>	DWS Full Width?	N/A
			<b>N/A</b>	DWS Offset (in)	N/A
			<b>N/A</b>	Gutter Slope (%)	N/A
			<b>N/A</b>	Gutter X Slope (%)	N/A
			<b>No</b>	Painted X Walk2?	N/A
				X Walk 2 Direction	To S
			<b>N/A</b>	X Walk 2 Width (in)	N/A
				X Walk 2 Slope (%)	2.2
				X Walk 2 X Slope (%)	5.9
			<b>N/A</b>	Ramp inside XWalk2?	N/A
			<b>N/A</b>	Clear Space?	N/A
			<b>N/A</b>	Clear Space to XWalk (in)	N/A
			<b>N/A</b>	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
			<b>N/A</b>		N/A
			<b>Yes</b>	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00			

