


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 15238Main Street: CLANTON\_RDCross Street: MANCHESTER\_DRLocation:SEADA ID: 2E327C69B6B7Ramp Type: ParaDiagInitial Pass/Fail: FailOverall Compliance: NoSeverity Score:35

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

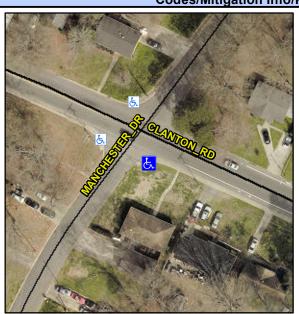

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

CLANTON RD None MANCHESTER DR StopSign Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.1, R304.3.2, R304.5.3

Total Cost: \$ 3200.00

Compliance Description Data			Compliance Description Data		
N/A	Ramp Length LT (in)	24.0	N/A	Ramp Length RT (in)	25.0
No	Ramp Width LT (in)	47.0	No	Ramp Width RT (in)	46.0
No	Ramp Slope LT (%)	16.2	Yes	Ramp Slope RT (%)	4.9
No	Ramp XSlope LT (%)	3.3	No	Ramp XSlope RT (%)	2.6
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.0		X Walk 2 Slope (%)	2.5
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	6.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.4	N/A	Clear Space?	N/A
	Road X Slope (%)	7.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.0
40.					





