


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 27855 Main Street: LUNDIN LINKS LN Cross Street: PINE_VALLEY_CLUB_DR Location: NE **ADA ID: 2FB90D22D7D3** Ramp Type: Perp Initial Pass/Fail: Pass **Overall Compliance: No Severity Score:** 10

Codes/Mitigation Info/Possible Solution

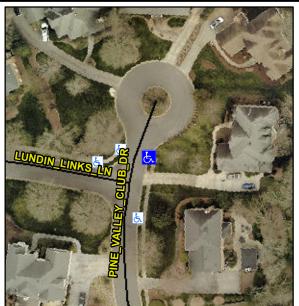

PINE VALLEY CLUB DR Street 1 Name Stop Condition-Street 2 None Street 2 Name N/A Stop Condition-Street 1 N/A

Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3

Total Cost: 1850.00

Field Measurements/Component Compliance					
Com	Compliance Description		Compliance Description		Data
N/A	Ramp Length (in)	94.0	Yes	Ramp Slope (%)	6.4
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.7	Yes	Flare Slope RT (%)	4.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good





