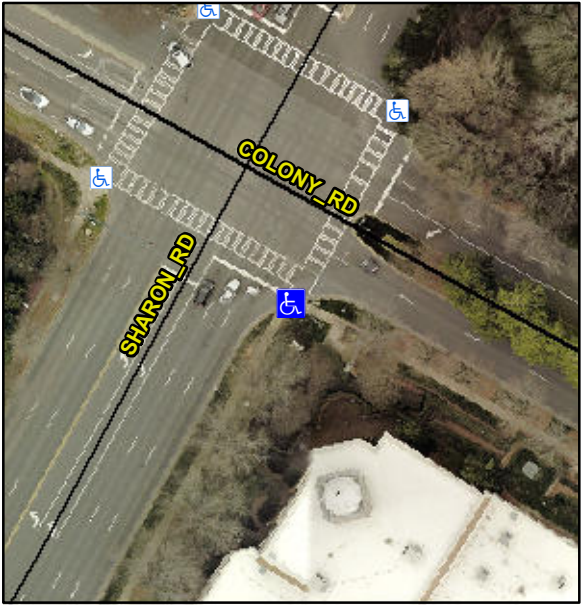


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 19799	Main Street: SHARON_RD	Cross Street: COLONY_RD	Location: S
ADA ID: 306F3F50B559	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk.</b>		N/A	Ramp Length (in)	60.0
			Yes	Ramp Width (in)	50.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.2.2, R304.5.3</b></p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	Yes
				X Walk 1 Direction	To NE
			N/A	X Walk 1 Width (in)	108.0
				X Walk 1 Slope (%)	0.2
				X Walk 1 X Slope (%)	2.0
			N/A	Ramp inside XWalk1?	Yes
				Road Slope (%)	1.9
				Road X Slope (%)	2.8
			N/A	Any Obstructions?	N/A
				Obstruction Type	
Total Cost:		\$ 3400.00			
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

