


Intersection ID: N/A	Main Street: 24TH_ST	Cross Street: N/A	Location:	NW
ADA ID: 32105865A782	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

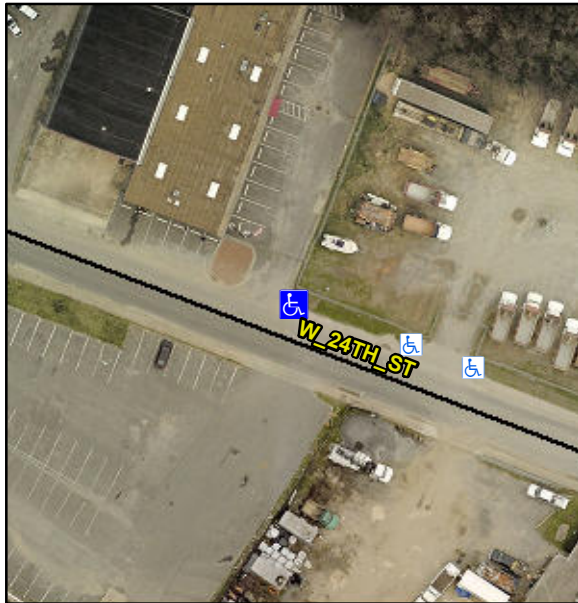

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

PONDING PREVENTED GTR SLOPES

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R302.7, R304.5.4

Street 1 Name	ENTRANCE
Stop Condition-Street 1	None
Street 2 Name	24TH ST
Stop Condition-Street 2	None

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.	N/A	Ramp Length LT (in)	55.0	N/A	Ramp Length RT (in)	57.0		
	Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0		
	Yes	Ramp Slope LT (%)	7.6	Yes	Ramp Slope RT (%)	3.0		
	No	Ramp XSlope LT (%)	2.6	No	Ramp XSlope RT (%)	2.9		
	Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes		
	Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes		
	No	Landing Slope (%)	6.7	Yes	DWS Length (in)	24.0		
	Yes	Landing X Slope (%)	1.0	Yes	DWS Full Width?	Yes		
	N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0		
	N/A	Shared Landing?	No					
PONDING PREVENTED GTR SLOPES	No	Gutter Ponding?	Yes	No	Gutter Slope (%)	N/A		
	Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	N/A		
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
		X Walk 1 Direction	To W		X Walk 2 Direction	To S		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
		X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	2.1		
		X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	0.6		
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
		Road Slope (%)	0.2	N/A	Clear Space?	Yes		
		Road X Slope (%)	5.8	N/A	Clear Space to XWalk (in)	N/A		
Surveyor Notes:	Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
		Obstruction Type			Storm Grate/Utility Type			
PROW/ADA:								
R304.5.3, R304.2.2-Perp, R304.3.2-Para, R302.7, R304.5.4								
Total Cost:								
	\$	3950.00		N/A		N/A		
					Yes	Surface Condition? (G/P)	Good	
				N/A	Curb Slope (%)	11.5		

