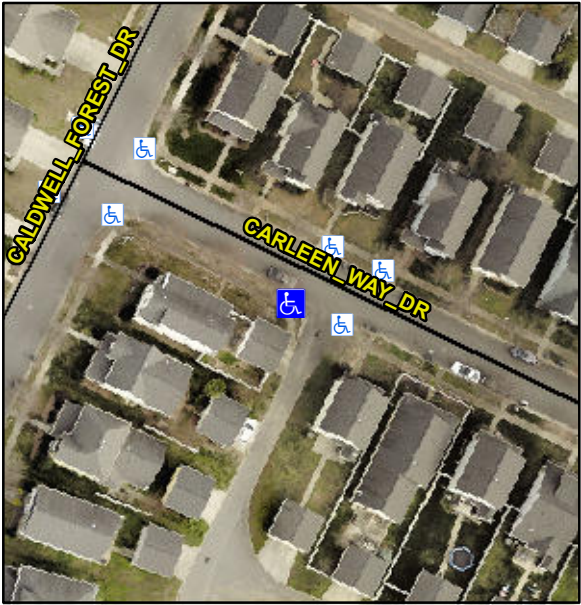


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10015045	Main Street: CARLEEN_WAY_DR	Cross Street: N/A	Location: W
ADA ID: 3277EF766CB6	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	57.5
			No	Ramp Width (in)	43.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
				X Walk 1 Direction	To S
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	10.2
				X Walk 1 X Slope (%)	0.4
			N/A	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			No	Painted X Walk2?	N/A
				X Walk 2 Direction	To E
			N/A	X Walk 2 Width (in)	N/A
				X Walk 2 Slope (%)	4.7
				X Walk 2 X Slope (%)	7.1
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Surface Condition? (G/P)	Good

