


Intersection ID: 3299	Main Street: BRANTHURST_DR	Cross Street: SPRING_PARK_DR	Location:	N
ADA ID: 3795FCBC9F9D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 36.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	95.0	Yes	Ramp Slope (%)	5.1
			No	Ramp Width (in)	26.0	No	Ramp XSlope (%)	4.6
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:  N/A		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A			Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:  Not Found, R304.5.1, R304.5.3		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To SW		X Walk 2 Direction	To SE	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	9.9	
			X Walk 1 X Slope (%)	6.8		X Walk 2 X Slope (%)	2.1	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	2.9	N/A	Clear Space?	N/A	
			Road X Slope (%)	8.4	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
						Yes	Surface Condition? (G/P)	Good
		Total Cost:	\$	3200.00				

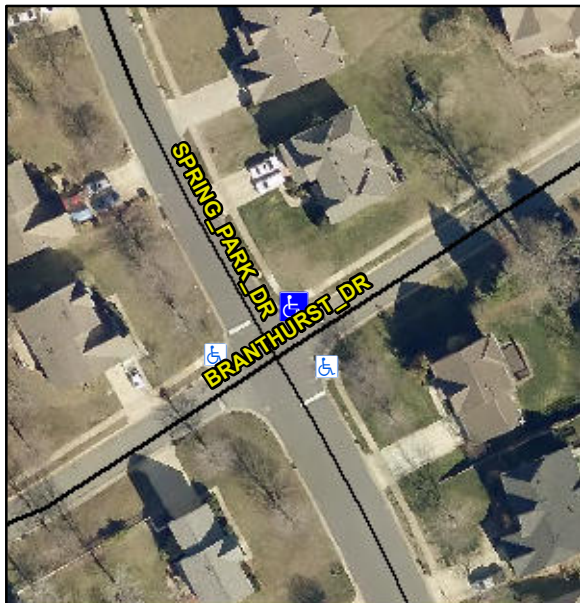