

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18365	Main Street: TRYON_ST	Cross Street: TYVOLA_RD	Location: W
ADA ID: 3837F3FEE9C7	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 15	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

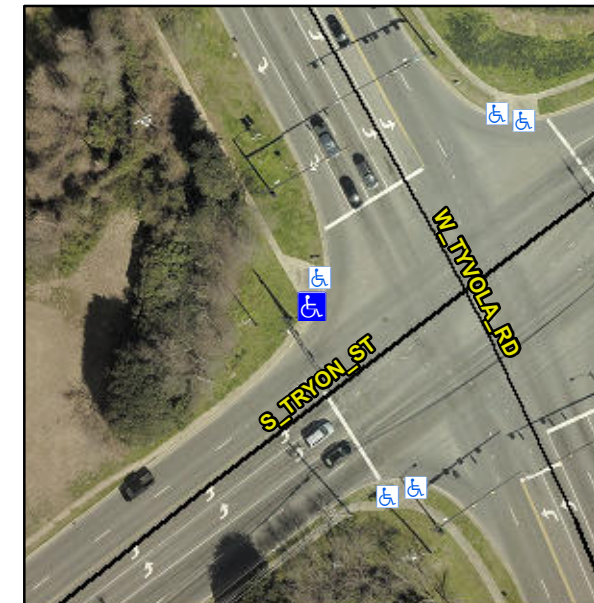

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	78.0	Yes	BlendTrans Slope (%)	0.6
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	6.2	Yes	Flare Slope RT (%)	5.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.6
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.4		Clear Space?	Yes
	Road X Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	15.6

Street 1 Name S TRYON ST

Stop Condition-Street 1 Signal

Street 2 Name N/A

Stop Condition-Street 2 N/A

