


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10029989Main Street:LANCASTER_HYCross Street:N/ALocation:NEADA ID: 38E5328D6751Ramp Type:ParaDiagInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

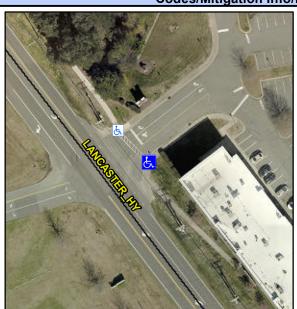

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

ENTRANCE StopSign LANCASTER HY None Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

Possible Solutions:

N/A

PROW/ADA:

R304.3.2, R304.5.3

Total Cost: \$ 3200.00

Compliance Description Data		Compliance Description		Data	
N/A	Ramp Length LT (in)	67.0	N/A	Ramp Length RT (in)	62.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	59.5
No	Ramp Slope LT (%)	8.7	Yes	Ramp Slope RT (%)	7.0
Yes	Ramp XSlope LT (%)	1.6	No	Ramp XSlope RT (%)	3.5
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	52.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	6.0
	X Walk 1 X Slope (%)	4.9		X Walk 2 X Slope (%)	6.7
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.1	N/A	Clear Space?	N/A
	Road X Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.8





