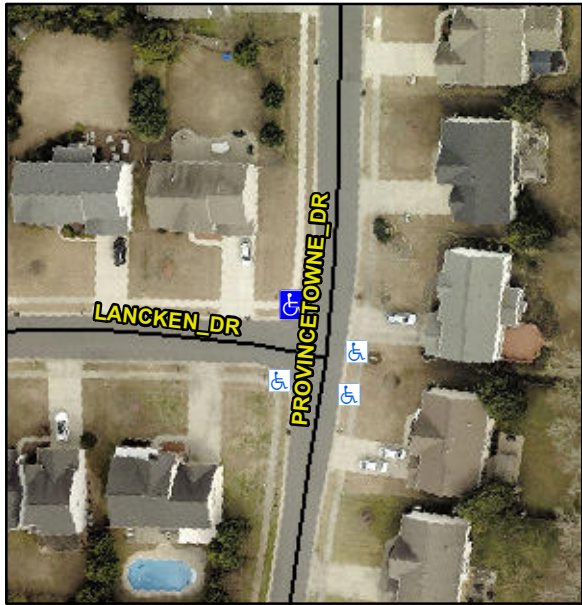


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 32204	Main Street: LANCKEN_DR	Cross Street: PROVINCETOWNE_DR	Location: NW
ADA ID: 3A7097007A8D	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	46.0	Yes	Ramp Slope (%)	7.4
			Yes	Ramp Width (in)	96.0	Yes	Ramp XSlope (%)	0.1
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	2.7	N/A	Flare Slope RT (%)	2.2
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	48.0	No	DWS Provided?	No
			Yes	Landing Width (in)	96.0	N/A	DWS Contrast?	No
			Yes	Landing Slope (%)	0.3	N/A	DWS Length (in)	N/A
			Yes	Landing X Slope (%)	0.1	N/A	DWS Full Width?	No
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R305, R302.7.2	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.4
			No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.8
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To SE		X Walk 2 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	1.9
				X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	1.0
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	0.8	N/A	Clear Space?	Yes
				Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00						

