


Intersection ID: 44684	Main Street: CEDAR_CROFT_DR	Cross Street: LARRISA_CT	Location:	NE
ADA ID: 3B024750FCF2	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 58.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

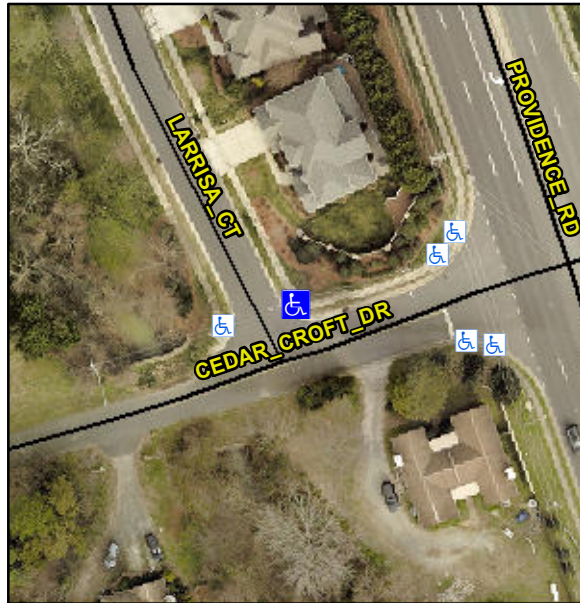

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.1, R304.2.2,
R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	13.2
No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	13.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.4		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	5.8		X Walk 2 X Slope (%)	9.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	9.1	N/A	Clear Space?	N/A
	Road X Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name	LARRISA CT
Stop Condition-Street 2	StopSign
Street 2 Name	CEDAR CROFT DR
Stop Condition-Street 1	None

