


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 47272Main Street: LEAHURST_CTCross Street: LIDDINGTON_RDLocation:SWADA ID: 3C6A055B7694Ramp Type: PerpDiagInitial Pass/Fail: FailOverall Compliance: NoSeverity Score:10

Codes/Mitigation Info/Possible Solution

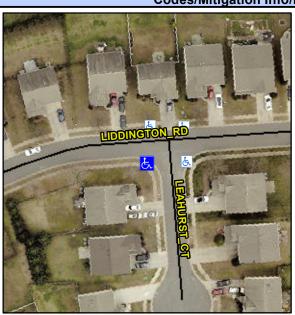

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

LEAHURST CT StopSign LIDDINGTON RD None

Possible Solutions:	
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	
Surveyor Notes: N/A	
PROW/ADA: Not Found, R304.5.1, R304.5.3	

Total Cost: \$ 3200.00

Field Measurements/Component Compliance							
Cor	npliance Description	Data	Comp	oliance Description	Data		
N/A	Ramp Length (in)	46.5	Yes	Ramp Slope (%)	6.3		
No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	3.7		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
	X Walk 1 Direction	To E		X Walk 2 Direction	To N		
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	5.0		X Walk 2 Slope (%)	2.6		
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	3.8		
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	2.1	N/A	Clear Space?	N/A		
	Road X Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		





