

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

2.7

2.8

N/A

10.2

Good

Intersection ID: 10018961 Main Street: ROCKY BROOK CT Cross Street: N/A Location: SE Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 10 ADA ID: 4211BC0B33D2 Ramp Type: BlendTrans1

Compliance Description

N/A

No

N/A

N/A

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

X Walk 1 Direction

X Walk 1 Width (in)

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)

Road X Slope (%)

Any Obstructions?

Obstruction Type

Flare Traversable LT?

Flare Type LT

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

No

N/A

Yes

No

Compliance Description

Flare Type RT

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

Clear Space?

Curb Slope (%)

Flare Traversable RT?

BlendTrans Slope (%)

BlendTrans XSlope (%)

Data

48.0

47.5

N/A

No

N/A

5.2

2.7

N/A


2.7

5.2

N/A

N/A

To NW

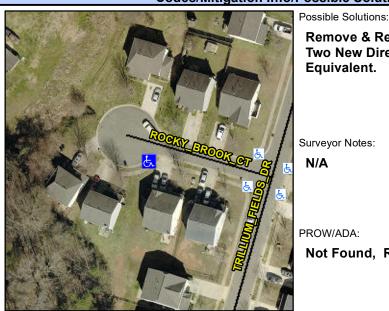

ROCKY BROOK CT Street 1 Name Stop Condition-Street 1 None N/A Street 2 Name Stop Condition-Street 2 N/A Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

				N/A
				N/A
Surveyor Notes:				N/A
N/A				N/A
				N/A
				N/A
				N/A
PROW/ADA:				N/A
Not Found,	R304.5.1, R304	.5.3		N/A
				N/A
				N/A
				N/A
Total Cost:	\$		3200.00	



