

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

12.5

1.1

N/A

Good

Intersection ID: 27855 Main Street: LUNDIN_LINKS_LN Cross Street: PINE_VALLEY_CLUB_DR Location: NW

ADA ID: 49876A7F84BC Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

Yes

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Data

46.0

43.0

N/A

No

N/A

5.8

1.1

N/A


N/A

N/A

N/A

N/A

To SE

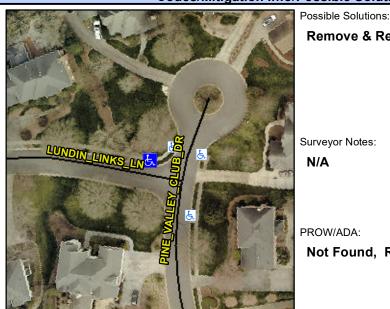

Street 1 Name
LUNDIN LINKS LN
Stop Condition-Street 2
StopSign
Street 2 Name
N/A
Stop Condition-Street 1
N/A

Remove & Replace Little Ramp.		
Surveyor Notes:		
·		
N/A		
PROW/ADA:		
Not Found, R304.5.1, R304.2.2		
I		

Remove & Replace Entire Ramp.

•	No	Ramp Width (in)
	N/A	Flare Type LT
	N/A	Flare Slope LT (%)
	N/A	Flare Traversable LT?
	N/A	Landing Length (in)
	N/A	Landing Width (in)
	N/A	Landing Slope (%)
	N/A	Landing X Slope (%)
	N/A	Landing Curb? (Y/N)
	N/A	Shared Landing?
	N/A	Gutter Ponding?
	N/A	Gutter Lip Ht (in)
	N/A	Painted X Walk1?
		X Walk 1 Direction
	N/A	X Walk 1 Width (in)
		X Walk 1 Slope (%)
		X Walk 1 X Slope (%)
	N/A	Ramp inside XWalk1?
		Road Slope (%)
		Road X Slope (%)
	N/A	Any Obstructions?
1850.00		Obstruction Type

N/A

Compliance Description

Ramp Length (in)







Total Cost: