


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: N/A Location: SW

ADA ID: 501574A069D1 Ramp Type: Perp Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

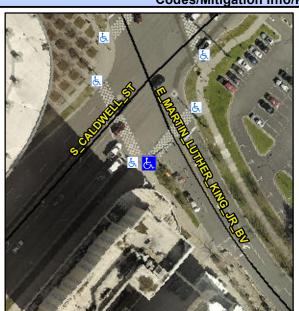

E MARTIN LUTHER KING JR BV Street 1 Name Stop Condition-Street 2 Signal Street 2 Name N/A Stop Condition-Street 1 N/A Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2

Total Cost: 1850.00

Field Measurements/Component Compliance					
Compliance Description		Data	Comp	liance Description	Data
N/A	Ramp Length (in)	95.0	No	Ramp Slope (%)	10.0
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	4.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	144.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good





