

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                          |                           |                        |
|------------------------|--------------------------|---------------------------|------------------------|
| Intersection ID: 12925 | Main Street: S_CHURCH_ST | Cross Street: W_CARSON_BV | Location: E            |
| ADA ID: 50C0CA963C1D   | Ramp Type: Directional1  | Initial Pass/Fail: Pass   | Overall Compliance: No |
|                        |                          |                           | Severity Score: 0.25   |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

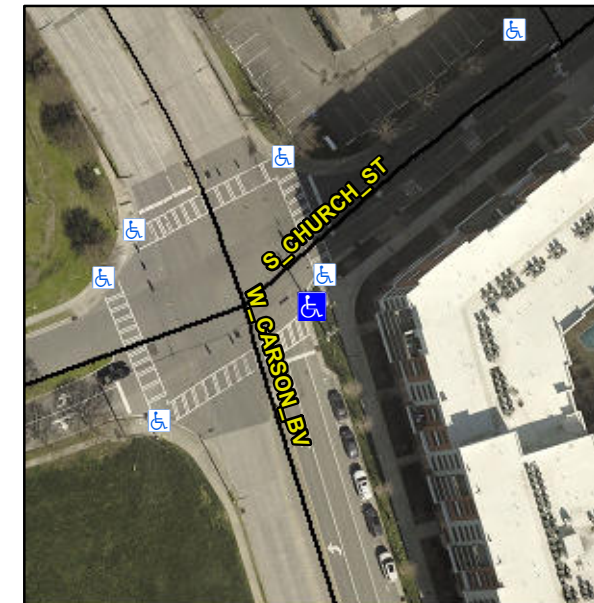

Possible Solutions:

**Remove & Replace Entire Ramp.  
Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R304.5.2**

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 75.0  | No         | Grade Break?                | No   |
| Yes        | Ramp Width (in)       | 67.0  | N/A        | Grade Break Slope (%)       | 4.6  |
| Yes        | Ramp Slope (%)        | 5.3   | N/A        | Grade Break XSlope (%)      | 3.6  |
| No         | Ramp XSlope (%)       | 3.5   |            |                             |      |
| Yes        | Flare Type LT         | N/A   | Yes        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | No    | N/A        | Flare Traversable RT?       | No   |
| No         | Landing Length (in)   | 45.0  | Yes        | DWS Provided?               | Yes  |
| Yes        | Landing Width (in)    | 71.0  | Yes        | DWS Contrast?               | Yes  |
| Yes        | Landing Slope (%)     | 1.7   | Yes        | DWS Length (in)             | 24.0 |
| No         | Landing X Slope (%)   | 2.6   | Yes        | DWS Full Width?             | Yes  |
| N/A        | Landing Curb? (Y/N)   | N/A   | Yes        | DWS Offset LT (in)          | 1.0  |
| N/A        | Shared Landing?       | No    | Yes        | DWS Offset RT (in)          | 35.0 |
| Yes        | Gutter Ponding?       | No    | Yes        | Gutter Slope (%)            | 2.8  |
| Yes        | Gutter Lip Ht (in)    | 0.0   | No         | Gutter X Slope (%)          | 4.4  |
| N/A        | Painted X Walk1?      | Yes   |            | Road Slope (%)              | 5.1  |
|            | X Walk 1 Direction    | To SW |            | Road X Slope (%)            | 2.5  |
|            | X Walk 1 Width (in)   | 135.0 |            | Clear Space?                | Yes  |
|            | X Walk 1 Slope (%)    | 5.1   | N/A        | Clear Space to XWalk (in)   | N/A  |
|            | X Walk 1 X Slope (%)  | 2.5   | Yes        | Storm Grate/Utility Hazard? | No   |
| Yes        | Ramp inside XWalk1?   | Yes   |            | Storm Grate/Utility Type    |      |
| Yes        | Any Obstructions?     | No    |            |                             | N/A  |
|            | Obstruction Type      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                       |       | N/A        | Curb Slope (%)              | 12.0 |

Total Cost: \$ 2350.00

