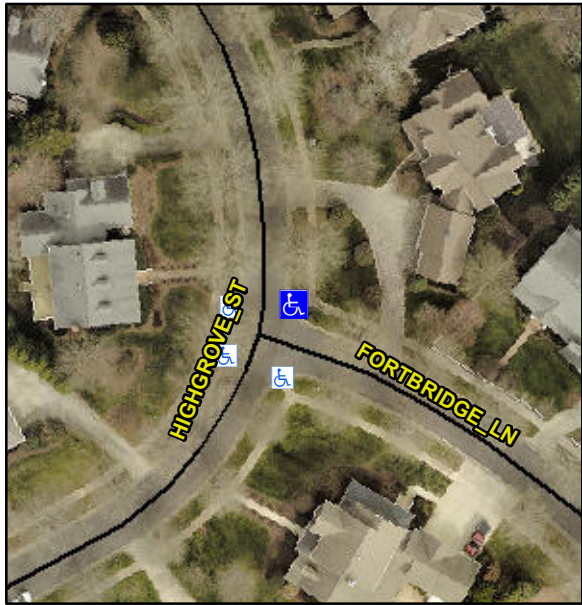


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28218	Main Street: FORTBRIDGE_LN	Cross Street: HIGHGROVE_ST	Location: NE
ADA ID: 51EA79BF777C	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance							
	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Compliance	Description	Data	Compliance	Description	Data
	Surveyor Notes:	N/A		N/A	Ramp Length (in)	102.0	No	Ramp Slope (%)	8.5
			Yes	Ramp Width (in)	54.0	No	Ramp XSlope (%)	3.8	
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
	PROW/ADA:	Not Found, R304.2.2, R304.5.3	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A			Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
		N/A	Shared Landing?	N/A					
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
			X Walk 1 Direction	To NW		X Walk 2 Direction	To SW		
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
			X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	2.9		
			X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	3.2		
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
			Road Slope (%)	1.5	N/A	Clear Space?	N/A		
			Road X Slope (%)	4.8	N/A	Clear Space to XWalk (in)	N/A		
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
			Obstruction Type			Storm Grate/Utility Type			
					N/A		N/A		
					Yes	Surface Condition? (G/P)	Good		

Street 1 Name	HIGHGROVE ST
Stop Condition-Street 2	None
Street 2 Name	FORTBRIDGE LN
Stop Condition-Street 1	StopSign

Total Cost:	\$	3200.00
-------------	----	---------

Total Cost: \$ 3200.00

