


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 32074 Main Street: SPRINGBANK LN **Cross Street: SPRINGS VILLAGE LN** Location: NW ADA ID: 5924EA7E8B78 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

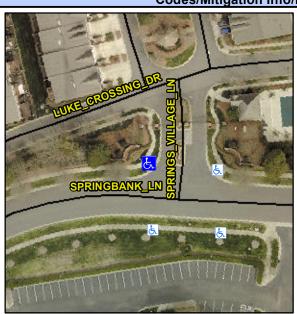

SPRINGBANK LN Street 1 Name Stop Condition-Street 2 None **SPRINGS VILLAGE LN** Street 2 Name Stop Condition-Street 1 StopSign Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: R304.2.2, R304.5.3

Total Cost: 3200.00

ried Measurements/Component Compnance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length (in)	96.0	No	Ramp Slope (%)	8.6
Yes	Ramp Width (in)	49.0	No	Ramp XSlope (%)	3.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.1		X Walk 2 Slope (%)	0.4
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	4.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.6	N/A	Clear Space?	N/A
	Road X Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A

Yes

Surface Condition? (G/P)

Good





