


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: N/A Main Street: E_MARTIN_LUTHER_KING_JR_GBt/ss Street: S_CALDWELL_ST Location: NW

ADA ID: 5A0911BBF53C Ramp Type: Perp Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 5.25

Codes/Mitigation Info/Possible Solution

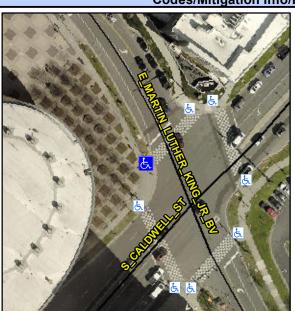

Street 1 Name E MARTIN LUTHER KING JR BV
Stop Condition-Street 2 Signal
Street 2 Name N/A
Stop Condition-Street 1 N/A

Possible Solutions:
Remove & Replace Entire Ramp. Remove & Replace Gutter.
Surveyor Notes:
N/A
PROW/ADA:
Not Found, R304.5.3, R305.2, R304.5.4
N304.3.4

Total Cost: \$ 2600.00

Field Measurements/Component Compliance						
Compliance Description Data		Data	Comp	liance Description	Data	
N/A	Ramp Length (in)	83.0	Yes	Ramp Slope (%)	5.2	
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.6	
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	5.0	N/A	Flare Slope RT (%)	8.4	
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No	
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes	
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes	
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.5	
Yes	Landing X Slope (%)	1.6	Yes	DWS Full Width?	Yes	
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5	
N/A	Shared Landing?	No				
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.9	
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.6	
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	144.0	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	N/A	
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear Space?	Yes	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	
INTO A P						





