

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

43.0

40.0

10.2

5.2

3.0

1.7

N/A

No

To N

N/A

3.2

3.1

N/A

N/A

Intersection ID: 14033 Main Street: ELMIN_ST Cross Street: MORNING_DR Location: SW

ADA ID: 5A38BFC0648C Ramp Type: Combination1Diag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance



Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

StopSign MORNING DR None

WEST BV

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.


Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.1, R304.5.1, R304.5.3, R304.3.2

Total Cost: \$ 3200.00

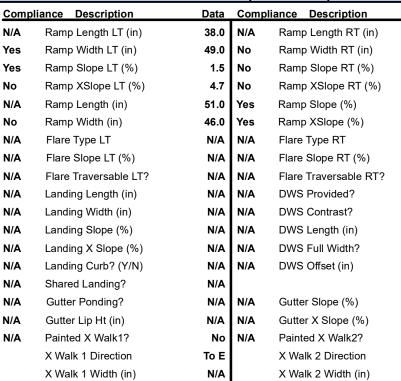

1.9

0.9

N/A

2.0

1.3

N/A





N/A

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)

N/A Clear Space to XWalk (in) N/A N/A Any Obstruction? N/A **Obstruction Type** N/A N/A Storm Grate/Utility Hazard? N/A Storm Grate/Utility Type N/A Yes Surface Condition? (G/P) Good 9.0 Curb Slope (%)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space?

